
UNIT – 4
VAPOUR POWER CYCLES

Carnot vapour power cycle, drawbacks as a reference cycle, simple Rankine cycle; description, T-s diagram, analysis for performance. Comparison of Carnot and Rankine cycles. Effects of pressure and temperature on Rankine cycle performance. Actual vapour power cycles. Ideal and practical regenerative Rankine cycles, open and closed feed water heaters. Reheat Rankine cycle.

Vapour power cycles are used in steam power plants. In a power cycle heat energy (released by the burning of fuel) is converted into work (shaft work), in which a working fluid repeatedly performs a succession of processes. In a vapour power cycle, the working fluid is water, which undergoes a change of phase.

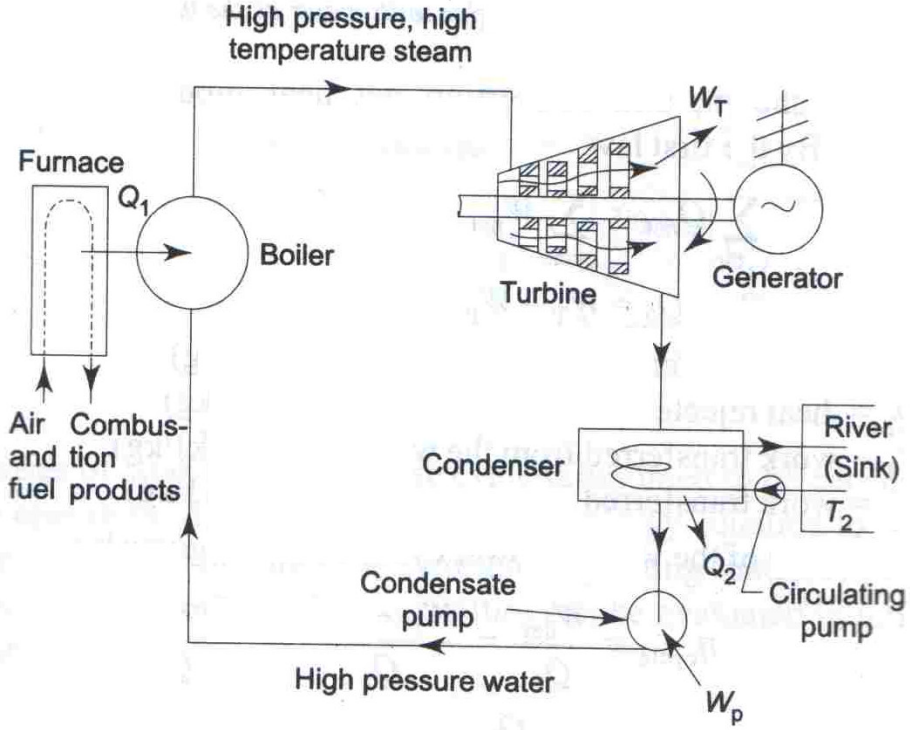

Simple steam power plant

Figure shows a simple steam power plant working on the vapour power cycle. Heat is transferred to the water in the boiler (Q_H) from an external source. (Furnace, where fuel is continuously burnt) to raise steam, the high pressure high temperature steam leaving the boiler expands in the turbine to produce shaft work (W_T), the steam leaving the turbine condenses into water in the condenser (where cooling water circulates), rejecting heat (Q_L), and then the water is pumped back (W_P) to the boiler.

Since the fluid is undergoing a cyclic process, the net energy transferred as heat during the cycle must equal the net energy transfer as work from the fluid.

GETMYUNI

By the 1st law of Thermodynamics,


$$\sum_{cycle} Q_{net} = \sum_{cycle} W_{net}$$

Or $Q_H - Q_L = W_T - W_P$

Where Q_H = heat transferred to the working fluid (kJ/kg)
Q_L = heat rejected from the working fluid (kJ/kg)
W_T = work transferred from the working fluid (kJ/kg)
W_P = work transferred into the working fluid (kJ/kg)

$$\therefore \quad \eta_{cycle} = \frac{W_{net}}{Q_H} = \frac{W_T - W_P}{Q_H} = \frac{Q_H - Q_L}{Q_H} = 1 - \frac{Q_L}{Q_H}$$

Idealized steam power cycles:

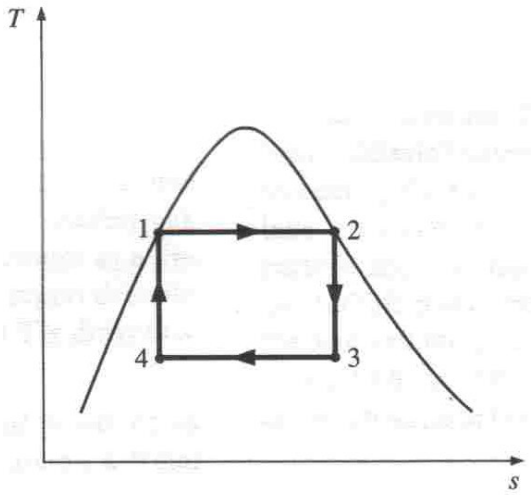

We know that the efficiency of a Carnot engine is maximum and it does not depend on the working fluid. It is, therefore, natural to examine of a steam power plant can be operated on the Carnot cycle.

Figure shows the Carnot cycle on the T-S diagram. Heat addition at constant pressure P_2, can be achieved isothermally in the process 1-2 in a boiler. The decrease in pressure from P_2 to P_3 in the process 2-3 can also be attained through the performance of work in a steam turbine. But in order to bring back the saturated liquid water to the boiler at the state 1, the condensation process 3-4 in the condenser must be terminated at the state 4, where the working fluid is a mixture of liquid water and vapour. But it is practically impossible to attain a condensation of this kind. Difficulty is also experienced in compressing isentropically the binary mixture from state 4 to the initial state 1, where the working fluid is entirely in the liquid state. Due to these inherent practical difficulties, Carnot cycle remains an ideal one.

GETMYUNI

Rankine Cycle: The simplest way of overcoming the inherent practical difficulties of the Carnot cycle without deviating too much from it is to keep the processes 1-2 and 2-3 of the latter unchanged and to continue the process 3-4 in the condenser until all the vapour has been converted into liquid water. Water is then pumped into the boiler upto the pressure corresponding to the state 1 and the cycle is completed. Such a cycle is known as the Rankine cycle. This theoretical cycle is free of all the practical limitations of the Carnot cycle.


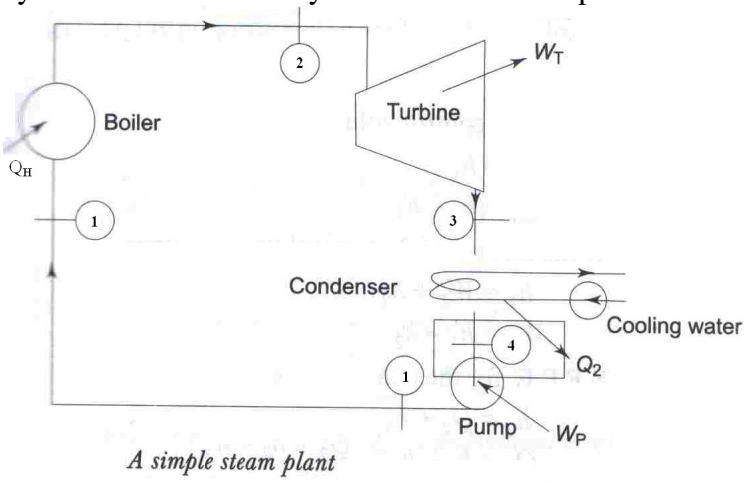


Figure (a) shows the schematic diagram for a simple steam power cycle which works on the principle of a Rankine cycle. Figure (b) represents the T-S diagram of the cycle.

The Rankine cycle comprises the following processes.

Process 1-2: Constant pressure heat transfer process in the boiler
Process 2-3: Reversible adiabatic expansion process in the steam turbine
Process 3-4: Constant pressure heat transfer process in the condenser and
Process 4-1: Reversible adiabatic compression process in the pump.

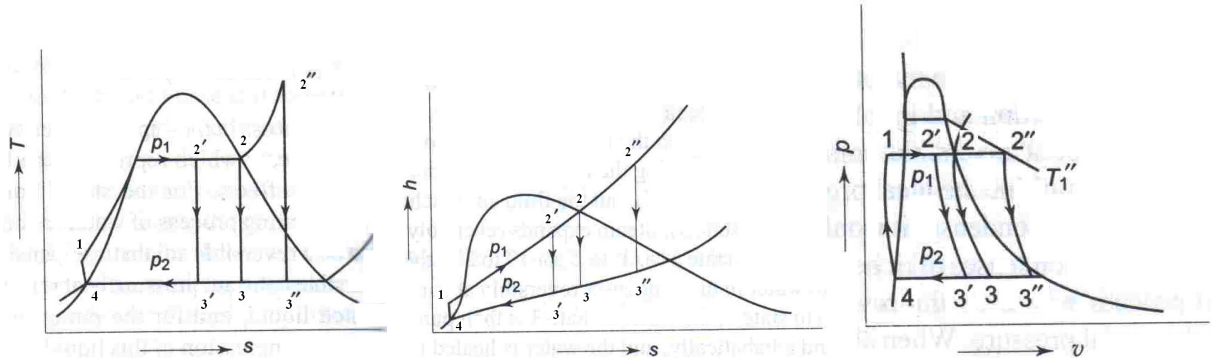

The numbers on the plots correspond to the numbers on the schematic diagram. For any given pressure, the steam approaching the turbine may be dry saturated (state 2), wet (state 2^1) or superheated (state 2^{11}), but the fluid approaching the pump is, in each case, saturated liquid (state 4). Steam expands reversibly and adiabatically in the turbine from state 2 to state 3 (or 2^1 to 3^1 or 2^{11} to 3^{11}), the steam leaving the turbine condenses to water in the condenser reversibly at constant pressure from state 3 (or 3^1, or 3^{11}) to state 4. Also, the water is heated in the boiler to form steam reversibly at constant pressure from state 1 to state 2 (or 2^1 or 2^{11})

GETMYUNI

Applying SFEE to each of the processes on the basis of unit mass of fluid and neglecting changes in KE & PE, the work and heat quantities can be evaluated.

For 1kg of fluid, the SFEE for the boiler as the CV, gives,
$h_1 + Q_H = h_2$ i.e., $Q_H = h_2 - h_1$ --- (1)
SFEE to turbine, $h_2 = W_T + h_3$ i.e., $W_T = h_2 - h_3$ --- (2)
SFEE to condenser, $h_3 \pm Q_L + h_4$ i.e., $Q_L = h_3 - h_4$ --- (3)
SFEE to pump, $h_4 + W_P = h_1$ i.e., $W_P = h_1 - h_4$ --- (4)

The efficiency of Rankine cycle is $\eta = \frac{W_{net}}{Q_H} = \frac{W_T - W_P}{Q_H}$

i.e., $\eta = \frac{(h_2 - h_3) - (h_1 - h_4)}{(h_2 - h_1)}$ or $\eta = \frac{(h_2 - h_1) - (h_3 - h_4)}{(h_2 - h_1)}$

The pump handles liquid water which is incompressible i.e., its density or specific volume undergoes little change with an increase in pressure.

For reversible adiabatic compression, we have Tds = dh – vdp; since ds = 0
We have, dh = vdp

Since change in specific volume is negligible, $\Delta h = v \Delta P$

Or $(h_1 - h_4) = v_4 (P_2 - P_3)$

Usually the pump work is quite small compared to the turbine work and is sometimes neglected. In that case, $h_1 = h_4$

$$\eta_{rankine} \cong \frac{(h_2 - h_3)}{(h_2 - h_1)} \cong \frac{(h_2 - h_3)}{(h_2 - h_4)}$$

The efficiency of the Rankine cycle is presented graphically in the T-S diagram

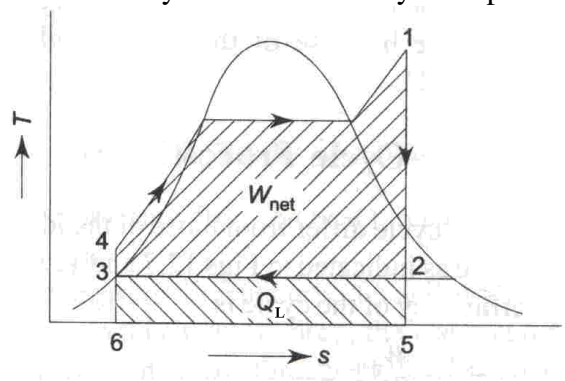


Fig. *Q_J, W_{net} and Q_L are proportional to areas*

GETMYUNI

Q_H α area 2-5-6-1,
Q_L α area 3-5-6-4

$W_{net} = (Q_H - Q_L)$ = area 1-2-3-4 enclosed by the cycle.

The capacity of the steam plant is expressed in terms of steam rate defined as the rate of steam flow (kg/h) required to produce unit shaft output (1kW)

$$\therefore \quad Steam\ rate = \frac{1}{W_T - W_P} \quad \frac{kg}{kJ} \quad \frac{1kJ/s}{1kW} \quad = \quad Specific\ Steam\ Consumption(SSC)$$


$$= \frac{1}{W_T - W_P} \quad \frac{kg}{kWs} \quad = \quad \frac{3600}{W_T - W_P} \quad \frac{kg}{kWh}$$

The cycle efficiency also expressed alternatively as heat rate which is the rate of heat input (Q_H) required to produce unit work output (1kW)

$$\text{Heat rate} = \frac{3600\ Q_H}{W_T - W_P} = \frac{3600}{\eta_{cycle}} \quad \frac{kJ}{kWh}$$

$$\text{Lastly, work ratio } r_w = \frac{\oint \delta W}{positive\ work} \quad = \quad \frac{(h_2 - h_3) - (h_1 - h_4)}{(h_2 - h_3)}$$

Comparison of Rankine and Carnot cycles

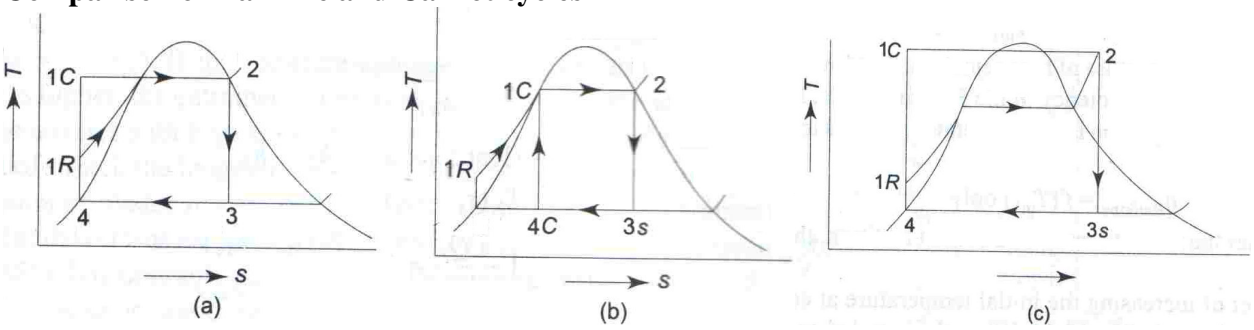

Carnot cycle has the maximum possible efficiency for the given limits of temperature. But it is not suitable in steam power plants. Figure shows the Rankine and Carnot cycles on the T-S diagram.
The reversible adiabatic expansion in the turbine, the constant temperature heat rejection in the condenser, and the Reversible adiabatic compression in the pump, are similar characteristic features of both the Rankine and Carnot cycles. But whereas the heat addition process in the Rankine cycle is reversible and at constant pressure, in the carnot cycle it is reversible and isothermal.

GETMYUNI

In Figures (a) and (c), Q_L is the same in both the cycles, but since Q_H is more, $\eta_C > \eta_R$. The two carnot cycles in Figure (a) and (b) have the same thermal efficiency. $\therefore$in Figure (b) also $\eta_C > \eta_R$.

But the Carnot cycle cannot be realized in practice because the pump work is very large. Whereas in (a) and (c) it is impossible to add heat at infinite pressures and at constant temperature from state 1C to state 2, in (b), it is difficult to control the quality at 4C, so that isentropic compression leads to a saturated liquid state.

Mean temperature of Heat addition

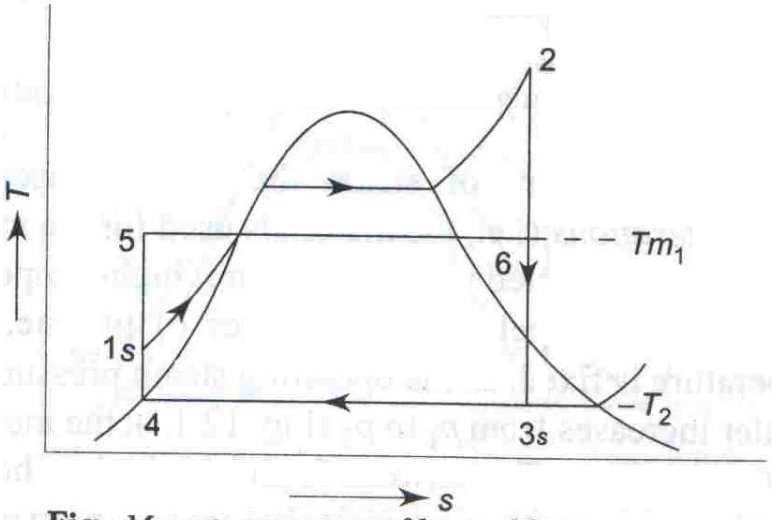


Fig. *Mean temperature of heat addition*

In the Rankine cycle, heat is added reversibly at a constant pressure, but at infinite temperatures. Let T_{m1}, is the mean temperature of heat addition, so that area under 1s and 2 is equal to the area under 5-6.

Heat added, $Q_H = h_2 - h_{1S} = T_{m1}\,(S_2 - S_{1S})$

$\therefore T_{m1}$ = Mean temperature of heat addition $= \dfrac{h_2 - h_{1S}}{S_2 - S_{1S}}$

Q_L = heat rejected $= h_{3S} - h_4$
$= T_3\,(S_2 - S_{1S})$

$$\therefore \quad \eta_R = 1 - \frac{Q_L}{Q_H} = 1 - \frac{T_3(S_2 - S_{1S})}{T_{m1}(S_2 - S_{1S})}$$

$$\eta_R = 1 - \frac{T_3}{T_{m1}}$$ where T_3 = temperature of heat rejection.

GETMYUNI

As T_3 is lowered for a given T_{m1}, the $\eta_R \uparrow$. But the lowest practical temperature of heat rejection is the ambient temperature T_0
i.e., $\eta_R = f(T_{m1})$ only.

Or higher the mean temperature of heat addition, the higher will be the cycle efficiency.

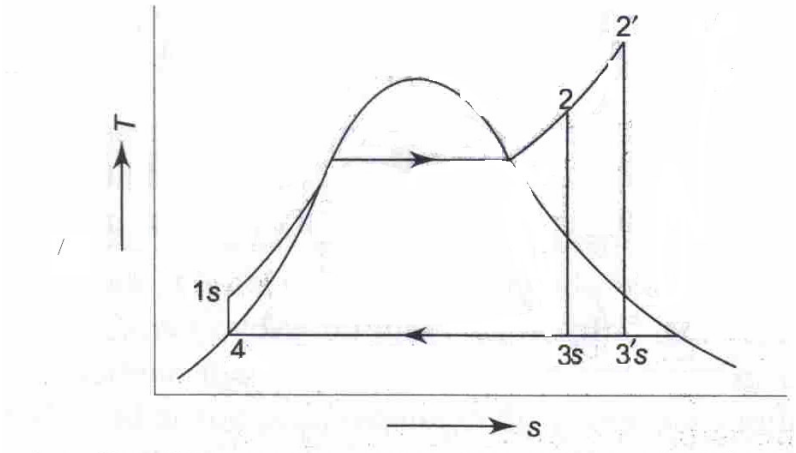


Fig. *Effect of superheat on mean temperature of heat addition*

The effect of increasing the initial temperature at constant pressure on cycle efficiency is shown in Figure. When the initial state changes from 2 to 2^1, T_{m1}, between 2 and 2^1 is higher than T_{m1} between 1s and 2. So an increase in the superheat at constant pressure increases the mean temperature of heat addition and hence the cycle η.

But the maximum temperature of steam that can be used is fixed from metallurgical considerations (i.e., materials used for the manufacture of the components which are subjected to high pressure, high temperature steam such as super heaters, valves, pipelines, inlet stages of turbines etc).

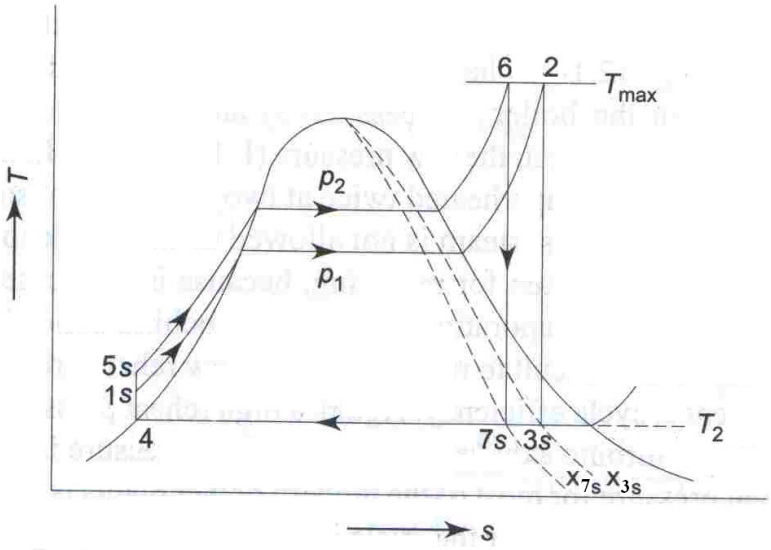


Fig. *Effect of increase of pressure on Rankine cycle*

GETMYUNI

When the maximum temperature is fixed, as the operating steam pressure at which heat is added in the boiler increases from P_1 to P_2, the mean temperature of heat addition increases (since T_{m1} between 5_S and 6 higher than between 1_S and 2). But when the turbine inlet pressure increases from P_1 to P_2, the ideal expansion line shifts to the left and the moisture content at the exhaust increases $(\because x_{7S} < x_{3S})$

If the moisture content of steam in the turbine is higher the entrained water particles along with the vapour coming out from the nozzles with high velocity strike the blades and erode their surfaces, as a result of which the longevity of the blades decreases. From this consideration, moisture content at the turbine exhaust is not allowed to exceed 15% or x < 0.85.

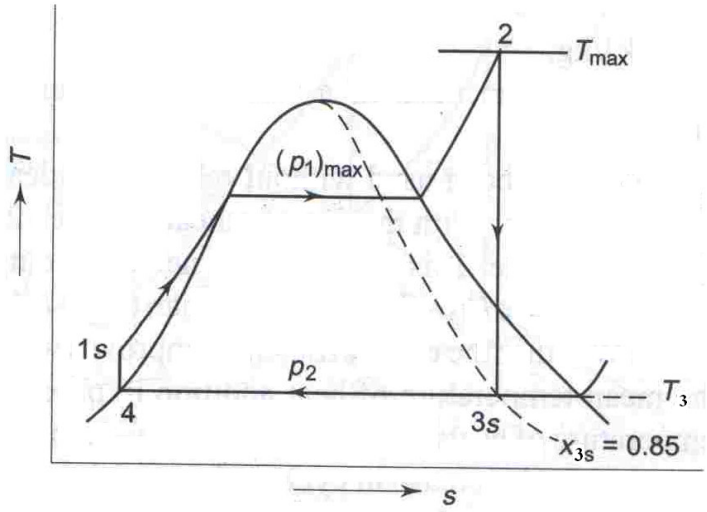


Fig. *Fixing of exhaust quality, maximum temperature and maximum pressure in Rankine cycle*

∴ With the maximum steam temperature at the turbine inlet, the minimum temperature of heat rejection and the minimum quality of steam at the turbine exhaust fixed, the maximum steam pressure at the turbine inlet also gets fixed. The vertical line drawn from 3S, fixed by T_3 and x_{3S}, intersects the T_{max} line, fixed by material, at 2, which gives maximum steam pressure at the turbine inlet.

GETMYUNI

Effect of Boiler Pressure (Using Molliar Diagram i.e., h-s diagram)

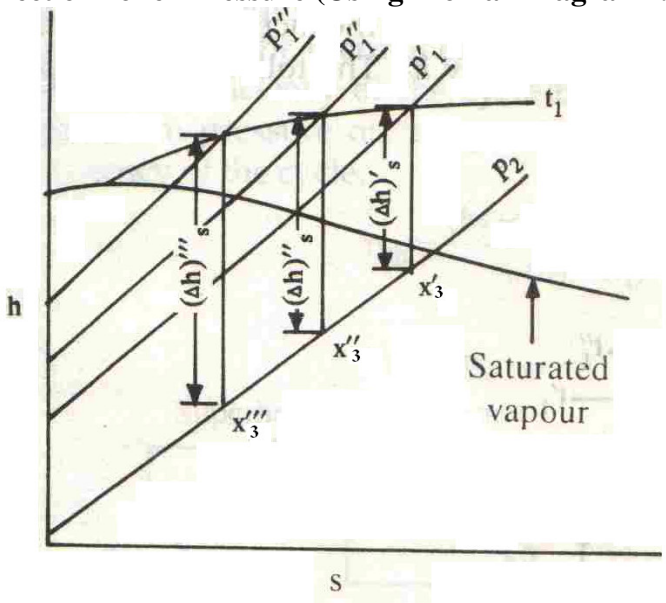


Fig. 13.5 Effect of boiler pressure

We have,

$$\eta_{th} = \frac{(h_2 - h_3) - (h_1 - h_4)}{h_2 - h_1} \text{ but } W_P << W_T$$

$$\therefore \eta_{th} = \frac{h_2 - h_3}{h_2 - h_1} = \frac{(\Delta h)_S}{(h_2 - h_1)}$$

i.e., Rankine cycle η depends on h_2, h_1 and Δh_S. From figure as $P_1''' > P_1'' > P_1'$ for the fixed maximum temperature of the steam t_1 and condenser pressure P_2, Isentropic heat drops increases with boiler pressure i.e., from the figure therefore it is evident that as boiler pressure increases, the isentropic heat drop $(\Delta h)_S$ increases, but the enthalpy of the steam entering the turbine decreases, with the result that the Rankine η increases. But quality of the steam at the exit of the turbine suffers i.e., $x_3''' < x_3'' < x_3'$, which leads to serious wear of the turbine blades.

GETMYUNI

Effect of Super Heating (Using Molliar Diagram i.e., h-s diagram)


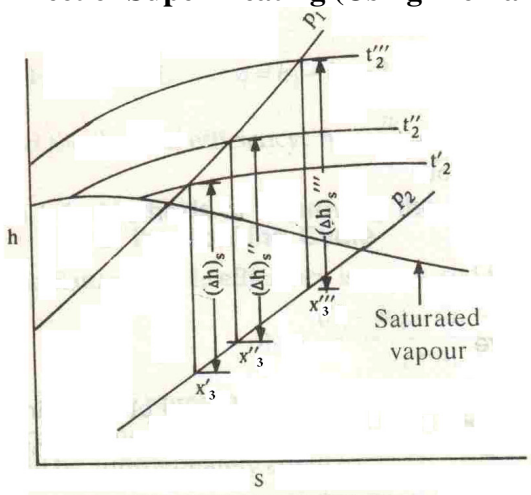


Fig. Effect of superheating

The moisture in the steam at the end of the expansion may be reduced by increasing the super heated temperature of steam t_2. This can be seen in figure where $t_2''' > t_2'' > t_2'$, but $x_3' < x_3'' < x_3'''$. It is, therefore, natural that to avoid erosion of the turbine blades, an increase in the boiler pressure must be accompanied by super heating at a higher temperature and since this raises the mean average temperature at which heat is transferred to the steam, the Rankine η increases.

Deviation of Actual Vapour Power cycles from Ideal cycle

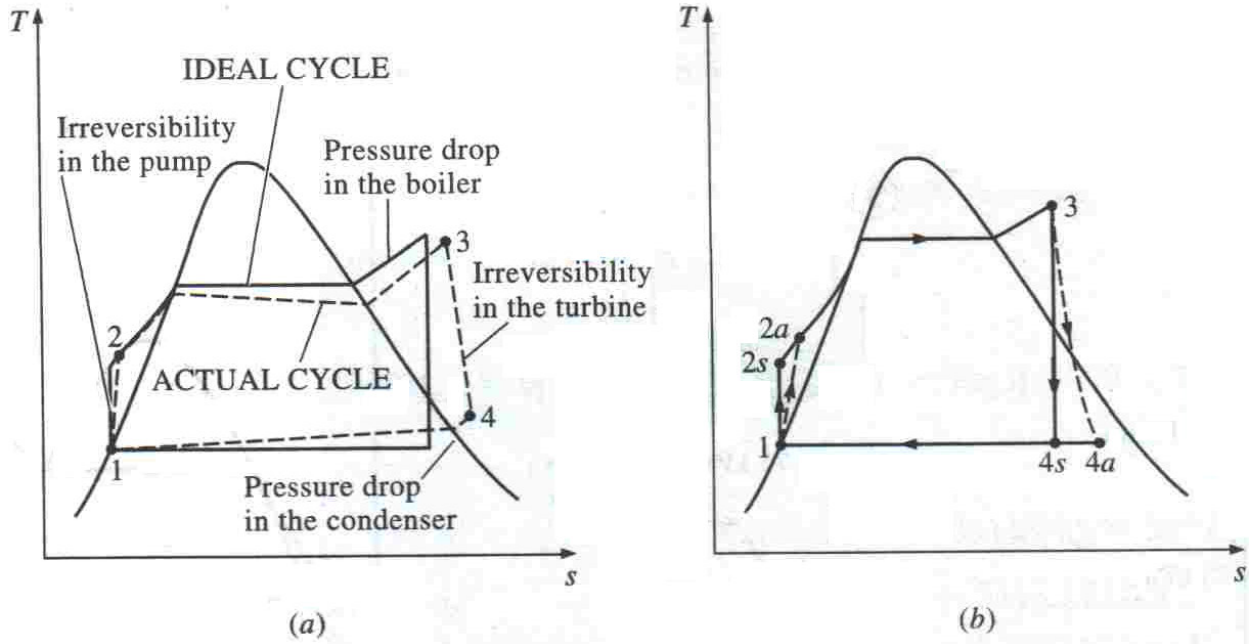

The actual Vapour power cycle differs from the ideal Rankine cycle, as shown in figure, as a result of irreversibilities in various components mainly because of fluid friction and heat loss to the surroundings.

GETMYUNI

Fluid friction causes pressure drops in the boiler, the condenser, and the piping between various components. As a result, steam leaves the boiler at a lower pressure. Also the pressure at the turbine inlet is lower than that at the boiler exit due to pressure drop in the connecting pipes. The pressure drop in the condenser is usually very small. To compensate these pressure drops, the water must be pumped to sufficiently higher pressure which requires the larger pump and larger work input to the pump.

The other major source of irreversibility is the heat loss from the steam to the surroundings as the steam flows through various components. To maintain the same level of net work output, more heat needs to be transferred to the steam in the boiler to compensate for these undesired heat losses. As a result, cycle efficiency decreases.

As a result of irreversibilities, a pump requires a greater work input, and a turbine produces a smaller work output. Under the ideal conditions, the flow through these devices are isentropic. The deviation of actual pumps and turbines from the isentropic ones can be accounted for by utilizing isentropic efficiencies, defined as

$$\eta_P = \frac{W_S}{W_a} = \frac{h_{1S} - h_4}{h_1 - h_4}$$


$$\text{And } \eta_t = \frac{W_a}{W_S} = \frac{h_2 - h_3}{h_2 - h_{3S}}$$

Problems:

1. **Dry saturated steam at 17.5 bar enters the turbine of a steam power plant and expands to the condenser pressure of 0.75 bar. Determine the Carnot and Rankine cycle efficiencies. Also find the work ratio of the Rankine cycle.**

Solution: $P_1 = 17.5$ bar $P_2 = 0.75$ bar $\eta_{Carnot} = ?$ $\eta_{Rankine} = ?$

a) Carnot cycle: At pressure 17.5 bar from steam tables,

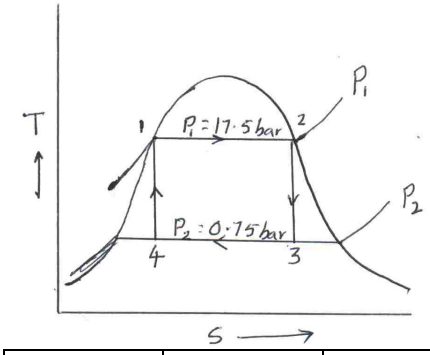

P	t_S	h_f	h_{fg}	h_g	S_f	S_{fg}	S_g
17	204.3	871.8	1921.6	2793.4	2.3712	4.0246	6.3958
18	207.11	884.5	1910.3	2794.8	2.3976	3.9776	6.3751

For P = 17.5 bar, using linear interpolation

GETMYUNI

For t_S, $204.3 + \frac{207.11 - 204.3}{1} x0.5 = 205.71^0 C$

$= 478.71$ K

Similarly, $h_f = 878.15$ kJ/kg $h_{fg} = 1915.95$ kJ/kg $h_g = 2794.1$ kJ/kg
$S_f = 2.3844$ kJ/kg^{0}K $S_{fg} = 4.0011$ kJ/kg^{0}K $S_g = 6.3855$ kJ/kg K

Also at pressure 0.75 bar from steam tables

P	t_S	h_f	h_{fg}	h_g	S_f	S_{fg}	S_g
0.8	93.51	391.7	2274.0	2665.8	1.233	6.2022	7.4352
0.7	89.96	376.8	2283.3	2660.1	1.1921	6.2883	7.4804

$\therefore$ For 0.75 bar, using linear interpolation,
$t_S = 91.74^0$C $h_f = 384.25$ $h_{fg} = 2278.65$ $h_g = 2662.95$
$S_f = 1.2126$ $S_{fg} = 6.2453$ $S_g = 7.4578$

The Carnot cycle η, $\eta_C = \frac{T_1 - T_2}{T_1} = \frac{478.71 - 364.74}{478.71} = 0.2381$

Steam rate or SSC $= \frac{1}{\oint \delta W} = \frac{1}{W_T - W_P}$

Since the expansion work is isentropic, $S_2 = S_3$

But $S_2 = S_g = 6.3855$ and $S_3 = S_{f3} + x_3 S_{fg3}$

i.e., $6.3855 = 1.2126 + x_3 (6.2453)$ $\therefore x_3 = 0.828$

$\therefore$ Enthalpy at state 3, $h_3 = h_{f3} + x_3 h_{fg3}$
$= 384.25 + 0.828 (2278.65) = 2271.63$ kJ/kg

$\therefore$ Turbine work or expansion work or positive work $= h_2 - h_3$
$= 2794.1 - 2271.63 = 522.47$ kJ/kg

Again since the compression process is isentropic
i.e., $S_4 = S_1 = S_{f1} = 2.3844$

Hence $2.3844 = S_{f4} + x_4 S_{fg4}$
$= 1.2126 + x_4 (6.2453)$ $\therefore x_4 = 0.188$

GETMYUNI

$\therefore$ Enthalpy at state 4 is $h_4 = h_{f4} + x_4\, h_{fg4}$


$= 384.25 + 0.188\ (2278.65)$
$= 811.79$ kJ/kg

$\therefore$ Compression work, $= h_1 - h_4 = 878.15 - 811.79$
$W_P = 66.36$ kJ/kg

$$\therefore SSC = \frac{1}{522.47 - 66.36} = 2.192\ x\ 10^{-3}\ kg/kJ$$

$$\text{work ratio} = r_w = \frac{\oint \delta w}{+ve\ work} = \frac{W_T - W_P}{W_T} = \frac{456.11}{522.47} = 0.873$$

b) Rankine cycle:

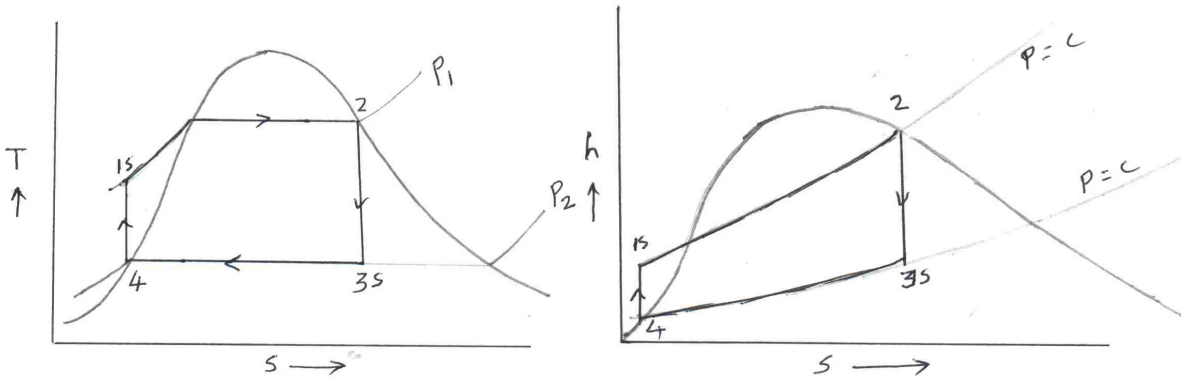

$$\eta_R = \frac{W_T - W_P}{Q_H} = \frac{(h_2 - h_3) - (h_1 - h_4)}{(h_2 - h_1)}$$

Since the change in volume of the saturated liquid water during compression from state 4 to state 1 is very small, v_4 may be taken as constant. In a steady flow process, work $W = -v\int dp$

$\therefore W_P = h_{1S} - h_4 = v_{fP2}\ (P_1 - P_2)$
$= 0.001037\ (17.5 - 0.75)\ x\ 10^5\ x\ (1/1000)$
$= 1.737$ kJ/kg
$\therefore h_{1S} = 1.737 + 384.25 = 385.99$ kJ/kg

Hence, turbine work $= W_T = h_2 - h_3 = 522.47$kJ/kg
Heat supplied $= Q_H = h_2 - h_{1S} = 2.794.1 - 385.99 = 2408.11$ kJ/kg

$$\therefore \eta_R = \frac{522.47 - 1.737}{2408.11} = 0.2162$$

$$\therefore SSC = \frac{1}{522.47 - 1.737} = 19204\ x\ 10^{-3}\ kg/kJ$$

GETMYUNI

Work ratio, $r_w = \frac{522.47 - 1737}{522.47} = 0.9967$

2. If in problem (1), the turbine and the pump have each 85% efficiency, find the % reduction in the net work and cycle efficiency for Rankine cycle.

Solution: If $\eta_P = 0.85$, $\eta_T = 0.85$

$$W_P = \frac{W_P}{0.85} = \frac{1.737}{0.85} = 2.0435 kJ/kg$$

$W_T = \eta_T W_T = 0.85\ (522.47) = 444.09$ kJ/kg

$\therefore W_{net} = W_T - W_P = 442.06$ kJ/kg

$\therefore$ % reduction in work output = $\frac{520.73 - 442.06}{520.73} = 15.11\%$

$W_P = h_{1S} - h_4\ \therefore h_{1S} = 2.0435 + 384.25 = 386.29$ kJ/kg

$\therefore Q_H - h_2 - h_{1S} = 2794.1 - 386.29 = 2407.81$ kJ/kg

$\therefore \eta_{cycle} = \frac{442.06}{2407.81} = 0.1836$

$\therefore$ % reduction in cycle efficiency $= \frac{0.2162 - 0.1836}{0.2162} = 15.08\%$

Note: Alternative method for problem 1 using h-s diagram (Mollier diagram) though the result may not be as accurate as the analytical solution. The method is as follows

Since steam is dry saturated at state 2, locate this state at the pressure P_2 = 17.5 bar on the saturation line and read the enthalpy at this state. This will give the value of h_2.

As the expansion process 2-3 is isentropic, draw a vertical line through the state 2 to meet the pressure line, P = 0.75 bar. The intersection of the vertical line with the pressure line will fix state 3. From the chart, find the value of h_3.

The value of h_4 can be found from the steam tables at pressure, P = 0.75 bar, as $h_4 = h_{f4}$. After finding the values of h_2, h_3 and h_4, apply the equation used in the analytical solution for determining the Rankine cycle η and SSC.

GETMYUNI

Effect of Boiler Pressure (Using Molliar Diagram i.e., h-s diagram)

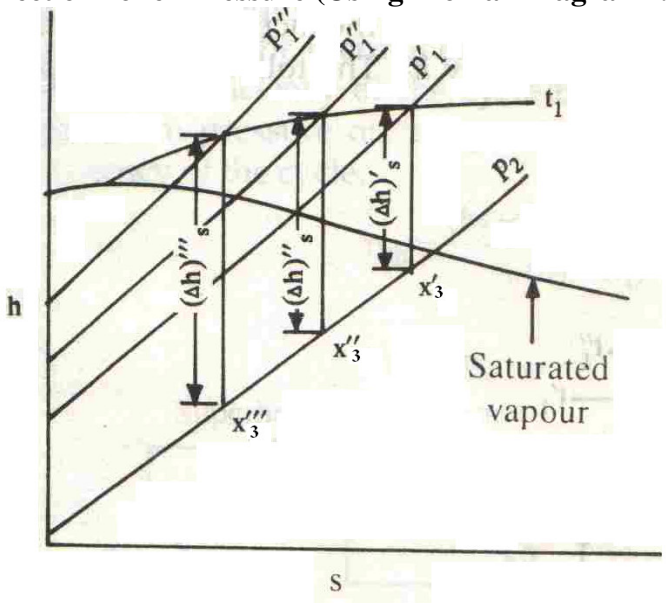


Fig. 13.5 Effect of boiler pressure

We have,

$$\eta_{th} = \frac{(h_2 - h_3) - (h_1 - h_4)}{h_2 - h_1} \text{ but } W_P << W_T$$

$$\therefore \eta_{th} = \frac{h_2 - h_3}{h_2 - h_1} = \frac{(\Delta h)_S}{(h_2 - h_1)}$$

i.e., Rankine cycle η depends on h_2, h_1 and Δh_S. From figure as $P_1''' > P_1'' > P_1'$ for the fixed maximum temperature of the steam t_1 and condenser pressure P_2, Isentropic heat drops increases with boiler pressure i.e., from the figure therefore it is evident that as boiler pressure increases, the isentropic heat drop $(\Delta h)_S$ increases, but the enthalpy of the steam entering the turbine decreases, with the result that the Rankine η increases. But quality of the steam at the exit of the turbine suffers i.e., $x_3''' < x_3'' < x_3'$, which leads to serious wear of the turbine blades.

GETMYUNI

Effect of Super Heating (Using Molliar Diagram i.e., h-s diagram)


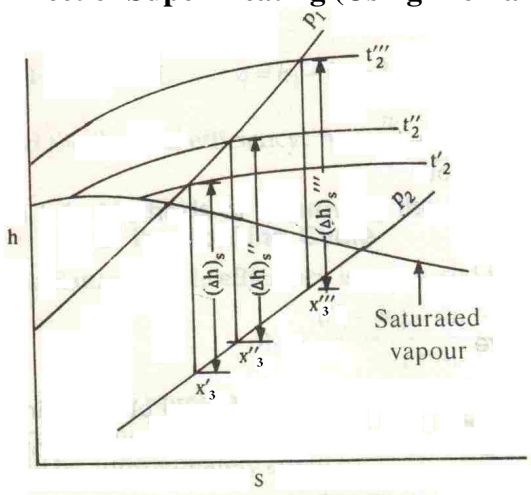


Fig. Effect of superheating

The moisture in the steam at the end of the expansion may be reduced by increasing the super heated temperature of steam t_1. This can be seen in figure where $t_1''' > t_1'' > t_1'$, but $x_3' < x_3'' < x_3'''$. It is, therefore, natural that to avoid erosion of the turbine blades, an increase in the boiler pressure must be accompanied by super heating at a higher temperature and since this raises the mean average temperature at which heat is transferred to the steam, the Rankine η increases.

Deviation of Actual Vapour Power cycles from Ideal cycle

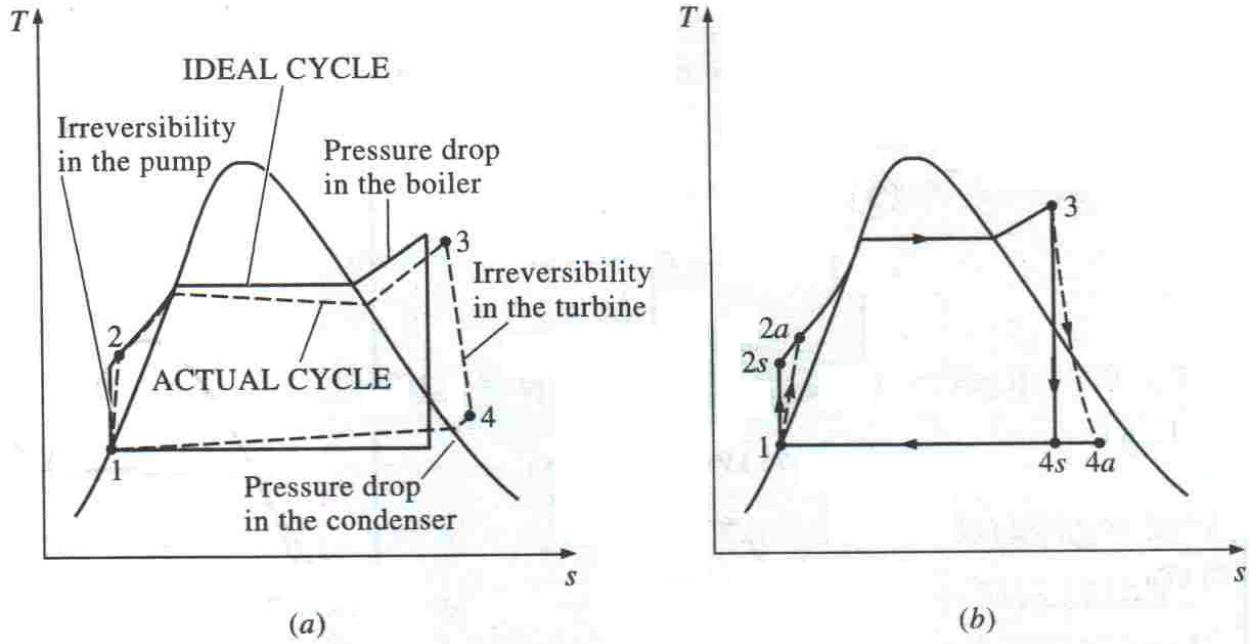

The actual Vapour power cycle differs from the ideal Rankine cycle, as shown in figure, as a result of irreversibilities in various components mainly because of fluid friction and heat loss to the surroundings.

GETMYUNI

Fluid friction causes pressure drops in the boiler, the condenser, and the piping between various components. As a result, steam leaves the boiler at a lower pressure. Also the pressure at the turbine inlet is lower than that at the boiler exit due to pressure drop in the connecting pipes. The pressure drop in the condenser is usually very small. To compensate these pressure drops, the water must be pumped to sufficiently higher pressure which requires the larger pump and larger work input to the pump.

The other major source of irreversibility is the heat loss from the steam to the surroundings as the steam flows through various components. To maintain the same level of net work output, more heat needs to be transferred to the steam in the boiler to compensate for these undesired heat losses. As a result, cycle efficiency decreases.

As a result of irreversibilities, a pump requires a greater work input, and a turbine produces a smaller work output. Under the ideal conditions, the flow through these devices are isentropic. The deviation of actual pumps and turbines from the isentropic ones can be accounted for by utilizing isentropic efficiencies, defined as

$$\eta_P = \frac{W_S}{W_a} = \frac{h_{1S} - h_4}{h_1 - h_4}$$


$$\text{And } \eta_t = \frac{W_a}{W_S} = \frac{h_2 - h_3}{h_2 - h_{3S}}$$

Numerical Problems:

1. **Dry saturated steam at 17.5 bar enters the turbine of a steam power plant and expands to the condenser pressure of 0.75 bar. Determine the Carnot and Rankine cycle efficiencies. Also find the work ratio of the Rankine cycle.**

Solution: $P_1 = 17.5$ bar $P_2 = 0.75$ bar $\eta_{Carnot} = ?$ $\eta_{Rankine} = ?$

a) Carnot cycle: At pressure 17.5 bar from steam tables,

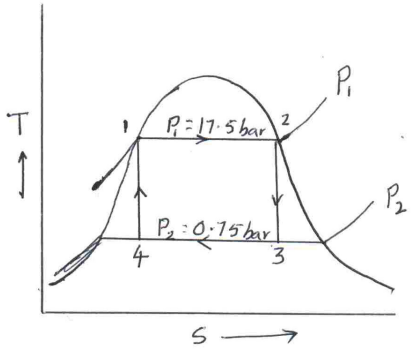

P	t_S	h_f	h_{fg}	h_g	S_f	S_{fg}	S_g
17	204.3	871.8	1921.6	2793.4	2.3712	4.0246	6.3958
18	207.11	884.5	1910.3	2794.8	2.3976	3.9776	6.3751

For P = 17.5 bar, using linear interpolation

GETMYUNI

For t_S, $204.3 + \frac{207.11 - 204.3}{1} x0.5 = 205.71^0 C$

$= 478.71$ K

Similarly, $h_f = 878.15$ kJ/kg $h_{fg} = 1915.95$ kJ/kg $h_g = 2794.1$ kJ/kg
$S_f = 2.3844$ kJ/kg^{0}K $S_{fg} = 4.0011$ kJ/kg^{0}K $S_g = 6.3855$ kJ/kg K

Also at pressure 0.75 bar from steam tables

P	t_S	h_f	h_{fg}	h_g	S_f	S_{fg}	S_g
0.8	93.51	391.7	2274.0	2665.8	1.233	6.2022	7.4352
0.7	89.96	376.8	2283.3	2660.1	1.1921	6.2883	7.4804

$\therefore$ For 0.75 bar, using linear interpolation,
$t_S = 91.74^0$C $h_f = 384.25$ $h_{fg} = 2278.65$ $h_g = 2662.95$
$S_f = 1.2126$ $S_{fg} = 6.2453$ $S_g = 7.4578$

The Carnot cycle η, $\eta_C = \frac{T_1 - T_2}{T_1} = \frac{478.71 - 364.74}{478.71} = 0.2381$

Steam rate or SSC $= \frac{1}{\oint \delta W} = \frac{1}{W_T - W_P}$

Since the expansion work is isentropic, $S_2 = S_3$

But $S_2 = S_g = 6.3855$ and $S_3 = S_{f3} + x_3 S_{fg3}$

i.e., $6.3855 = 1.2126 + x_3 (6.2453)$ $\therefore x_3 = 0.828$

$\therefore$ Enthalpy at state 3, $h_3 = h_{f3} + x_3 h_{fg3}$
$= 384.25 + 0.828 (2278.65) = 2271.63$ kJ/kg

$\therefore$ Turbine work or expansion work or positive work $= h_2 - h_3$
$= 2794.1 - 2271.63 = 522.47$ kJ/kg

Again since the compression process is isentropic
i.e., $S_4 = S_1 = S_{f1} = 2.3844$

Hence $2.3844 = S_{f4} + x_4 S_{fg4}$
$= 1.2126 + x_4 (6.2453)$ $\therefore x_4 = 0.188$

GETMYUNI

$\therefore$ Enthalpy at state 4 is $h_4 = h_{f4} + x_4\, h_{fg4}$


$= 384.25 + 0.188\ (2278.65)$
$= 811.79$ kJ/kg

$\therefore$ Compression work, $= h_1 - h_4 = 878.15 - 811.79$
$W_P = 66.36$ kJ/kg

$$\therefore SSC = \frac{1}{522.47 - 66.36} = 2.192\ x\ 10^{-3}\ kg/kJ$$

$$\text{work ratio} = r_w = \frac{\oint \delta w}{+ve\ work} = \frac{W_T - W_P}{W_T} = \frac{456.11}{522.47} = 0.873$$

b) Rankine cycle:

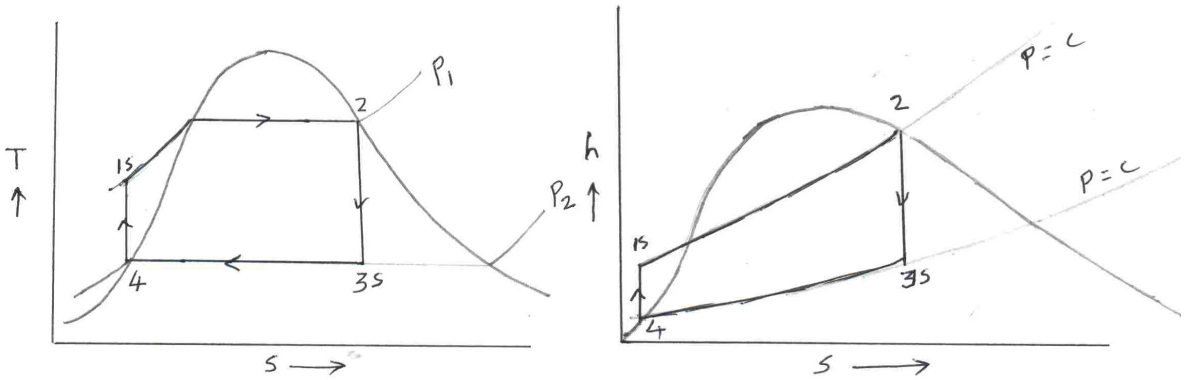

$$\eta_R = \frac{W_T - W_P}{Q_H} = \frac{(h_2 - h_3) - (h_1 - h_4)}{(h_2 - h_1)}$$

Since the change in volume of the saturated liquid water during compression from state 4 to state 1 is very small, v_4 may be taken as constant. In a steady flow process, work $W = -v\int dp$

$\therefore W_P = h_{1S} - h_4 = v_{fP2}\ (P_1 - P_2)$
$= 0.001037\ (17.5 - 0.75)\ x\ 10^5\ x\ (1/1000)$
$= 1.737$ kJ/kg
$\therefore h_{1S} = 1.737 + 384.25 = 385.99$ kJ/kg

Hence, turbine work $= W_T = h_2 - h_3 = 522.47$kJ/kg
Heat supplied $= Q_H = h_2 - h_{1S} = 2.794.1 - 385.99 = 2408.11$ kJ/kg

$$\therefore \eta_R = \frac{522.47 - 1.737}{2408.11} = 0.2162$$

$$\therefore SSC = \frac{1}{522.47 - 1.737} = 19204\ x\ 10^{-3}\ kg/kJ$$

GETMYUNI

Work ratio, $r_w = \frac{522.47 - 1737}{522.47} = 0.9967$

2. If in problem (1), the turbine and the pump have each 85% efficiency, find the % reduction in the net work and cycle efficiency for Rankine cycle.

Solution: If $\eta_P = 0.85$, $\eta_T = 0.85$

$$W_P = \frac{W_P}{0.85} = \frac{1.737}{0.85} = 2.0435 kJ/kg$$

$W_T = \eta_T W_T = 0.85\ (522.47) = 444.09$ kJ/kg

$\therefore W_{net} = W_T - W_P = 442.06$ kJ/kg

$\therefore$ % reduction in work output = $\frac{520.73 - 442.06}{520.73} = 15.11\%$

$W_P = h_{1S} - h_4\ \therefore h_{1S} = 2.0435 + 384.25 = 386.29$ kJ/kg

$\therefore Q_H - h_2 - h_{1S} = 2794.1 - 386.29 = 2407.81$ kJ/kg

$\therefore \eta_{cycle} = \frac{442.06}{2407.81} = 0.1836$

$\therefore$ % reduction in cycle efficiency $= \frac{0.2162 - 0.1836}{0.2162} = 15.08\%$

Note: Alternative method for problem 1 using h-s diagram (Mollier diagram) though the result may not be as accurate as the analytical solution. The method is as follows

Since steam is dry saturated at state 2, locate this state at the pressure P_2 = 17.5 bar on the saturation line and read the enthalpy at this state. This will give the value of h_2.


As the expansion process 2-3 is isentropic, draw a vertical line through the state 2 to meet the pressure line, P = 0.75 bar. The intersection of the vertical line with the pressure line will fix state 3. From the chart, find the value of h_3.

The value of h_4 can be found from the steam tables at pressure, P = 0.75 bar, as $h_4 = h_{f4}$. After finding the values of h_2, h_3 and h_4, apply the equation used in the analytical solution for determining the Rankine cycle η and SSC.

GETMYUNI

3. Steam enters the turbine of a steam power plant, operating on Rankine cycle, at 10 bar, 300^{0}C. The condenser pressure is 0.1 bar. Steam leaving the turbine is 90% dry. Calculate the adiabatic efficiency of the turbine and also the cycle η, neglecting pump work.

Solution:

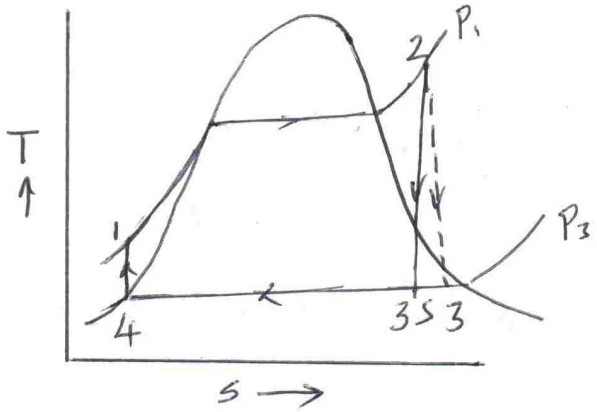

P_1 = 10 bar $t_2 = 300^0$C P_3 = 0.1 bar

x_3 = 0.9 η_t = ? η_{cycle} = ? Neglect W_P

From superheated steam tables,

For P_2 = 10 bar and $t_2 = 300^0$C, h_2 = 3052.1 kJ/kg, s_2 = 7.1251 kJ/kg

From table A – 1, For P_3 = 0.1 bar

$t_S = 45.83^0$C h_f = 191.8 h_{fg} = 2392.9

S_f = 0.6493 S_{fg} = 7.5018

Since x_3 = 0.9, $h_3 = h_{f4} + x_3 h_{fg3}$

= 191.8 +0.9 (2392.9)

= 2345.4 kJ/kg

Also, since process 2-3s is isentropic, $S_2 = S_{3S}$

i.e., $7.1251 = S_{fg4} + x_{3S} S_{fg3}$

$= 0.6493 + x_{3S} (7.5018)$

$\therefore x_{3S} = 0.863$

$\therefore h_{3S} = 191.8 + 0.863 (2392.9) = 2257.43$ kJ/kg

GETMYUNI


$$\therefore Turbine\ efficiency, \eta_t = \frac{h_2 - h_3}{h_2 - h_{3S}} = \frac{3052.1 - 2345.4}{3052.1 - 2257.43} = 0.89$$

$$\eta_{cycle} = \frac{W_T}{Q_H} = \frac{h_2 - h_3}{h_2 - h_1} \quad but \quad h_1 = 191.8\ \text{kJ/kg}$$

$$= \frac{3052.1 - 2345.4}{3052.1 - 191.8} = 0.25 \quad i.e., \quad 25\%$$

4. A 40 mW steam plant working on Rankine cycle operates between boiler pressure of 4 MPa and condenser pressure of 10 KPa. The steam leaves the boiler and enters the steam turbine at 400^0C. The isentropic η of the steam turbine is 85%. Determine (i) the cycle η (ii) the quality of steam from the turbine and (iii) the steam flow rate in kg per hour. Consider pump work.

Solution:

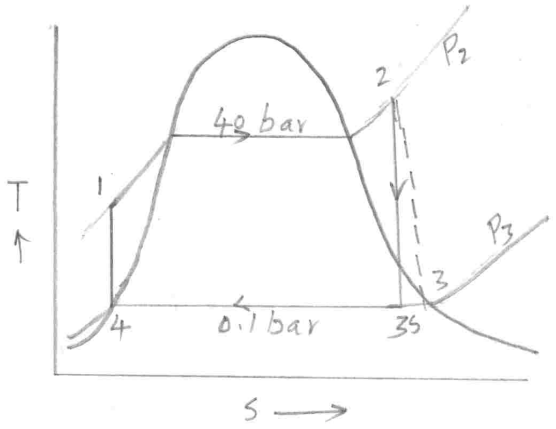

P_2 = 4 MPa = 40 bar P_3 = 10 KPa = 0.1 bar

P = 40000kW $t_2 = 400^0$C $\eta_t = 0.85$ η_{cycle} = ? x_3 = ?

$\dot{m}$ = ?

$$h_2 = h\big|_{40\,bar,\,400^0\,C} = 3215.7 kJ/kg \text{ and } s_2 = 6.7733 \text{ kJ/kg-K}$$

$$h_4 = h_f\big|_{0.1\,bar} = 191.8 kJ/kg$$

Process 2-3s is isentropic i.e., $S_2 = S_{3S}$

$$6.7733 = 0.6493 + x_{3S}\,(7.5018)$$

$$\therefore x_{3S} = 0.816$$

GETMYUNI

$\therefore h_{3S} = h_{f3} + x_{3S}\, h_{fg3} = 191.8 + 0.816\ (2392.9)$

$= 2145.2$ kJ/kg

$$But \quad \eta_t = \frac{h_2 - h_3}{h_2 - h_{3S}} \quad i.e., \quad 0.85 = \frac{3215.7 - h_3}{3215.7 - 2145.2}$$

$\therefore h_3 = 2305.8$ kJ/kg

$\therefore W_T = h_2 - h_3 = 3215.7 - 2305.8 = 909.9$ kJ/kg

$W_P = v\int dP \qquad = 0.0010102\ (40 - 0.1)\ 10^5/10^2$

$= 4.031$ kJ/kg

$= h_1 - h_4 \qquad \therefore h_1 = 195.8$ kJ/kg

$$(i)\ \eta_{cycle} = \frac{W_{net}}{Q_1} = \frac{909.9 - 4.031}{(3215.7 - 195.8)} = 29.9\%$$

(ii) $x_3 = ?$ we have $2305.8 = 191.8 + x_3\ (2392.9) \qquad \therefore x_3 = 0.88$

(iii) $P = \dot{m}\, W_{net}$ i.e., $40000 = \dot{m}\ (905.87)$

$\therefore \dot{m} = 44.2$ kg/s

$= 159120$ kg/hr

Ideal Reheat cycle: We know that, the efficiency of the Rankine cycle could be increased by increasing steam pressure in the boiler and superheating the steam. But this increases the moisture content of the steam in the lower pressure stages in the turbine, which may lead to erosion of the turbine blade. ∴The reheat cycle has been developed to take advantage of the increased pressure of the boiler, avoiding the excessive moisture of the steam in the low pressure stages. In the reheat cycle, steam after partial expansion in the turbine is brought back to the boiler, reheated by combustion gases and then fed back to the turbine for further expansion.

GETMYUNI


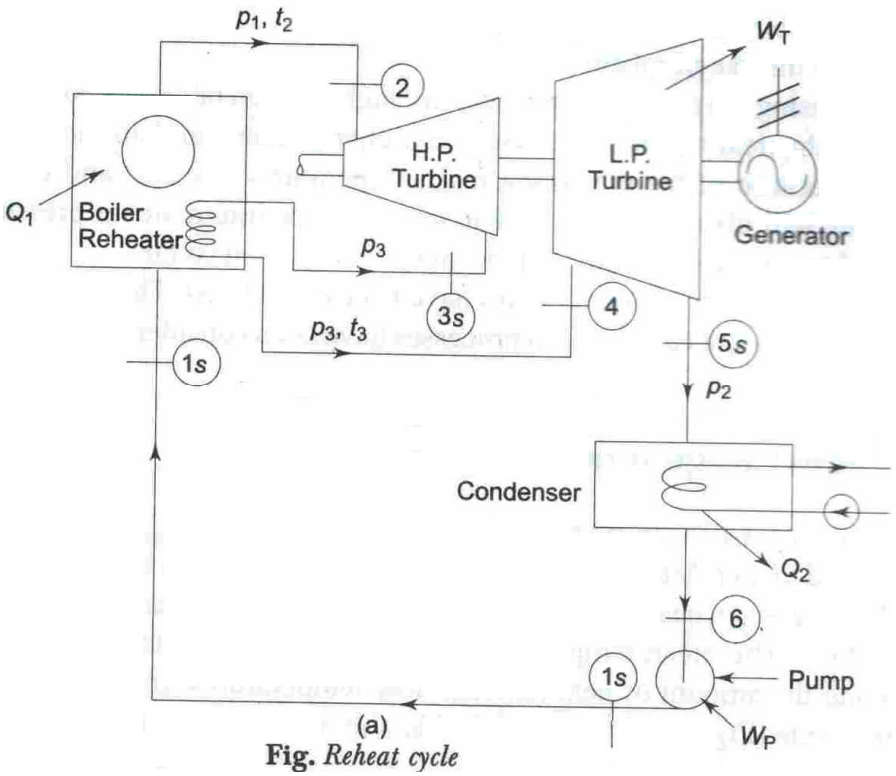


Fig. *Reheat cycle*

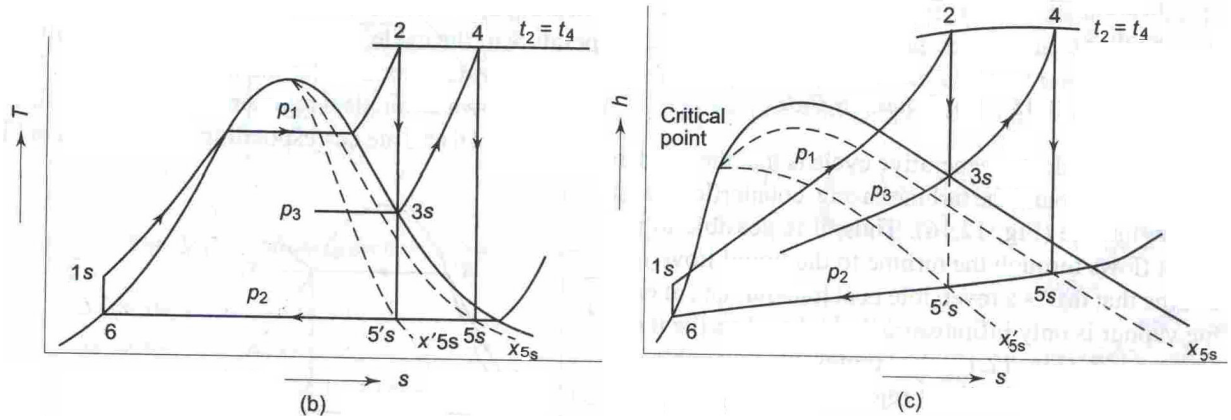

In the reheat cycle the expansion of steam from the initial state (2) to the condenser pressure is carried out in two or more steps, depending upon the number of reheats used.

In the first step, steam expands in HP turbine from state 2 to approximate the saturated vapour line (process 2-3s). The steam is then reheated (or resuperheated) at constant pressure in the boiler (or in a reheater) process 3s-4 and the remaining expansion process 4s-5 is carried out in the LP turbine.

Note: 1) To protect the reheater tubes, steam is not allowed to expand deep into the two-phase region before it is taken for reheating, because in that case the moisture particles in steam while evaporating would leave behind solid deposits in the form of scale which is difficult to remove. Also a low reheat pressure may bring down T_{ml} and hence cycle η. Again a high reheat pressure

GETMYUNI

increases the moisture content at turbine exhaust. Thus reheat pressure is optimized. Optimum reheat pressure is about 0.2 to 0.25 of initial pressure.

We have for 1 kg of steam

$Q_H = (h_2 - h_{1S}) + (h_4 - h_{3S})$; $Q_L = h_{5S} - h_6$
$W_T = (h_2 - h_{3S}) + (h_4 - h_{5S})$; $W_P = h_{1S} - h_6$

$$\therefore \quad \eta_R = \frac{W_T - W_P}{Q_H} \ ;$$

$$\text{Steam rate} = \frac{3600}{(W_T - W_P)} kg/kWh$$

Since higher reheat pressure is used, W_P work is appreciable.

2) In practice, the use of reheat gives a marginal increase in cycle η, but it increases the net work output by making possible the use of higher pressures, keeping the quality of steam at turbine exhaust within a permissible limit. The quality improves from x_{5^1S} to x_{5S} by the use of reheat.

GETMYUNI

Ideal Regenerative cycle: The mean temperature of heat addition can also be increased by decreasing the amount of heat added at low temperatures. In a simple Rankine cycle (saturated steam entering the turbine), a considerable part of the total heat supplied is in the liquid phase when heating up water from 1 to 1^1, at a temperature lower than T_2, the maximum temperature of the cycle. For maximum η, all heat should be supplied at T_2, and feed water should enter the boiler at 1^1. This may be accomplished in what is known as an ideal regenerative cycle as shown in figures (a) and (b).

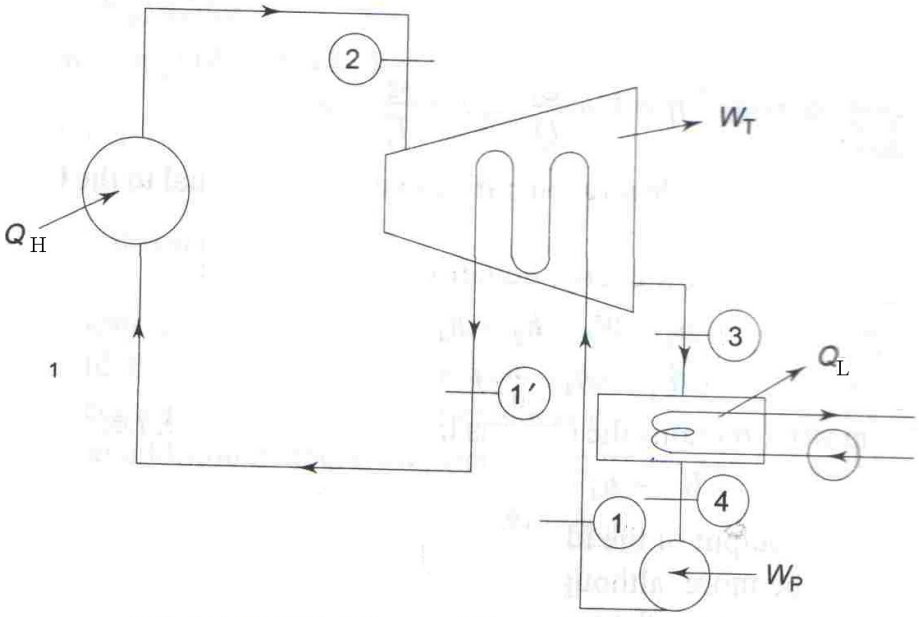


Fig. *Ideal regenerative cycle*

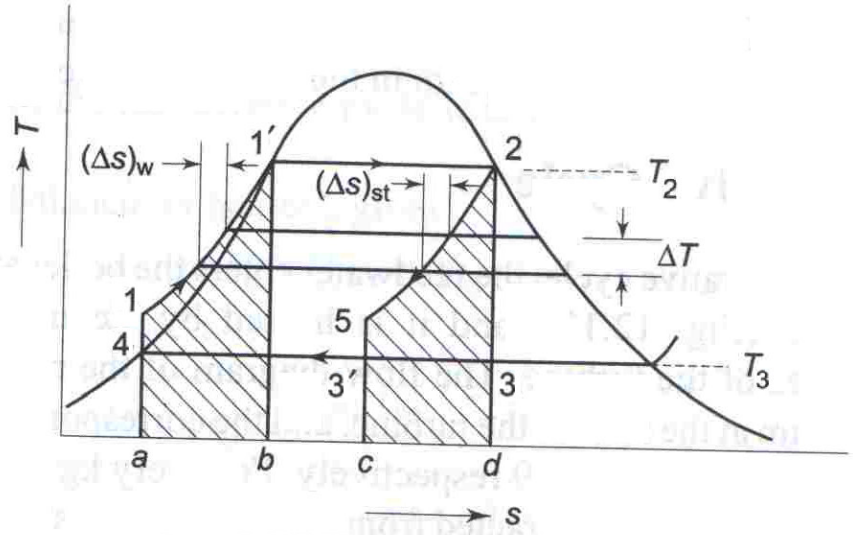


Fig. *Ideal regenerative cycle on T-s plot*

$$\Delta T(\text{water}) = -\Delta T\,(\text{steam})$$

GETMYUNI

The unique feature of the ideal regenerative cycle is that the condensate, after leaving the pump circulates around the turbine casing, counter-flow to the direction of vapour flow in the turbine. Thus it is possible to transfer heat from the vapour as it flows through the turbine to the liquid flowing around the turbine.

Let us assume that this is a reversible heat transfer i.e., at each point, the temperature of the vapour is only infinitesimally higher than the temperature of the liquid. ∴The process $2\text{-}3^1$ represents reversible expansion of steam in the turbine with reversible heat rejection. i.e., for any small step in the process of heating the water $\Delta T_{(water)} = -\Delta T_{(steam)}$ and $(\Delta S)_{water} = (\Delta S)_{steam}$. Then the slopes of lines $2\text{-}3^1$ and $1^1\text{-}4$ will be identical at every temperature and the lines will be identical in contour. Areas $1\text{-}1^1\text{-b-a-}1$ and $3^1\text{-}2\text{-d-c-}3^1$ are not only equal but congruous. ∴, all heat added from external source (Q_H) is at constant temperature T_2 and all heat rejected (Q_L) is at constant temperature T_3, both being reversible.

Then $Q_H = h_2 - h_1^1 = T_2 (S_2 - S_1^1)$

$Q_L = h_3^1 - h_4 = T_3 (S_3^1 - S_4)$

Since $S_1^1 - S_4 = S_2 - S_3^1$ or $S_2 - S_1^1 = S_3^1 - S_4$

∴ $\eta_{Reg} = 1 - \frac{Q_L}{Q_H} = 1 - \frac{T_3}{T_2}$ i.e., the η of ideal regenerative cycle is thus equal to the Carnot cycle η.

Writing SFEE to turbine,

$h_2 + h_1 = W_T + h_1^1 + h_3^1$

i.e., $W_T = (h_2 - h_3^1) - (h_1^1 - h_1)$

or $W_T = (h_2 - h_3^1) - (h_1^1 - h_1)$ --- (1)

and the W_P is same as simple rankine cycle i.e., $W_P = (h_1 - h_4)$

∴The net work output of the ideal regenerative cycle is less and hence its steam rate will be more. Although it is more efficient when compared to rankine cycle, this cycle is not practicable for the following reasons.

1) Reversible heat transfer cannot be obtained in finite time.
2) Heat exchanger in the turbine is mechanically impracticable.
3) The moisture content of the steam in the turbine is high.

GETMYUNI

Regenerative cycle:



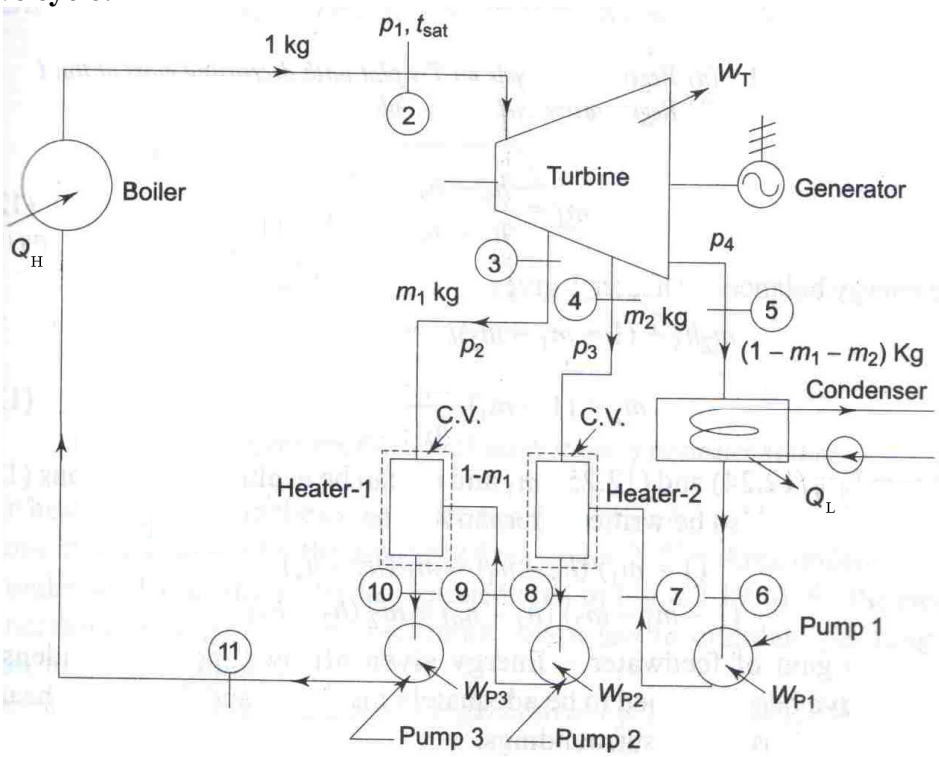


Fig. *Regenerative cycle flow diagram with two feedwater heaters*

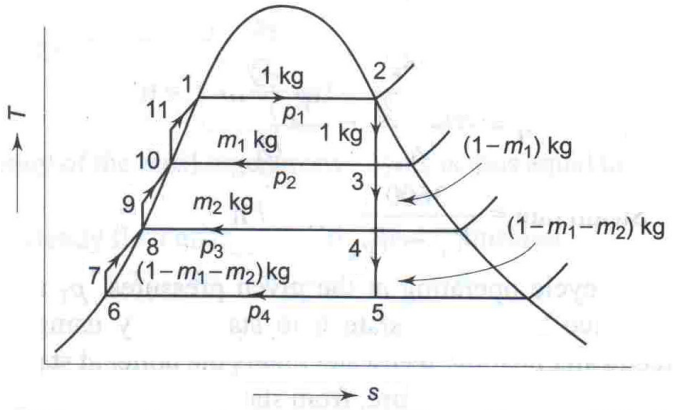

(a) Regenerative cycle on T-s plot with decreasing mass of fluid

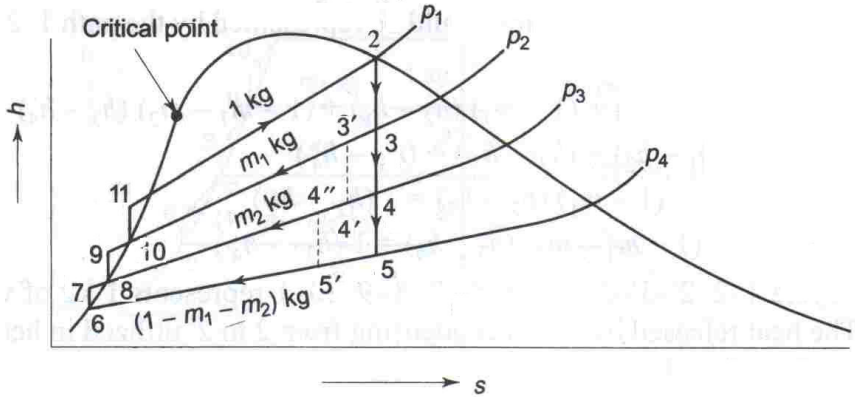

GETMYUNI

In a practical regenerative cycle, the feed water enters the boiler at a temperature between 1 and 1^1 (previous article figure), and it is heated by steam extracted from intermediate stages of the turbine. The flow diagram of the regenerative cycle with saturated steam at the inlet to the turbine and the corresponding T-S diagram are shown in figure.

For every kg of steam entering the turbine, let m_1 kg steam be extracted from an intermediate stage of the turbine where the pressure is P_2, and it is used to heat up feed water [$(1 - m_1)$ kg at state 9] by mixing in heater (1). The remaining $(1-m_1)$ kg of steam then expands in the turbine from pressure P_2 (state 3) to pressure P_3 (state 4) when m_2 kg of steam is extracted for heating feed water in heater (2). So $(1 - m_1 - m_2)$kg of steam then expands in the remaining stages of the turbine to pressure P_4, gets condensed into water in the condenser, and then pumped to heater (2), where it mixes with m_2 kg of steam extracted at pressure P_3. Then $(1-m_1)$ kg of water is pumped to heater (1) where it mixes with m_1 kg of steam extracted at pressure P_2. The resulting 1kg of steam is then pumped to the boiler where heat from an external source is supplied. Heaters 1 and 2 thus operate at pressure P_2 and P_3 respectively. The amounts of steam m_1 and m_2 extracted from the turbine are such that at the exit from each of the heaters, the state is saturated liquid at the respective pressures.

$\therefore$ Turbine work, $W_T = 1(h_2 - h_3) + (1 - m_1)(h_3 - h_4) + (1 - m_1 - m_2)(h_4 - h_5)$

Pump work, $W_P = W_{P1} + W_{P2} + W_{P3}$

$= (1 - m_1 - m_2)(h_7 - h_6) + (1 - m_1)(h_9 - h_8) + 1(h_{11} - h_{10})$

$Q_H = (h_2 - h_{11})$; $Q_L = (1 - m_1 - m_2)(h_5 - h_6)$

$\therefore$ Cycle efficiency, $\eta = \dfrac{Q_H - Q_L}{Q_H} = \dfrac{W_T - W_P}{Q_H}$

$$SSC = \frac{3600}{W_T - W_P} kg/kWh$$

In the Rankine cycle operating at the given pressure P_1 and P_4, the heat addition would have been from state 7 to state 2. By using two stages of regenerative feed water heating., feed water enters the boiler at state 11, instead of state 7, and heat addition is, therefore from state 11 to state 2.

Therefore $(T_{m1})_{with\ regeneration} = \dfrac{h_2 - h_{11}}{S_2 - S_{11}}$

And $(T_{m1})_{without\ regeneration} = \dfrac{h_2 - h_7}{S_2 - S_7}$

Since $(T_{m1})_{\text{with regenerative}} > (T_{m1})_{\text{without regenerative}}$, the η of the regenerative cycle will be higher than that of the Rankine cycle.

The energy balance for heater 1,

$m_1 h_3 + (1 - m_1) h_9 = 1\ h_{10}$

$$\therefore m_1 = \frac{h_{10} - h_9}{h_3 - h_9} \quad \text{--- (1)}$$

GETMYUNI

The energy balance for heater 2,

$m_2 h_4 + (1 - m_1 - m_2) h_7 = (1 - m_1) h_8$

Or $m_2 = (1 - m_1)\dfrac{(h_8 - h_7)}{(h_4 - h_7)}$ --- (2)

Above equations (1) and (2) can also be written alternatively as

$(1 - m_1)(h_{10} - h_9) = m_1 (h_3 - h_{10})$


and $(1 - m_1 - m_2)(h_8 - h_7) = m_2 (h_4 - h_8)$

Energy gain of feed water = energy given off by vapour in condensation.

Heaters have been assumed to be adequately insulated and there is no heat gain from, or heat loss to, the surroundings.

In figure (a) path 2-3-4-5 represents the states of a decreasing mass of fluid.

For 1kg of steam, the states would be represented by the path $2\text{-}3^1\text{-}4^{11}\text{-}5^1$. [Figure (b)].

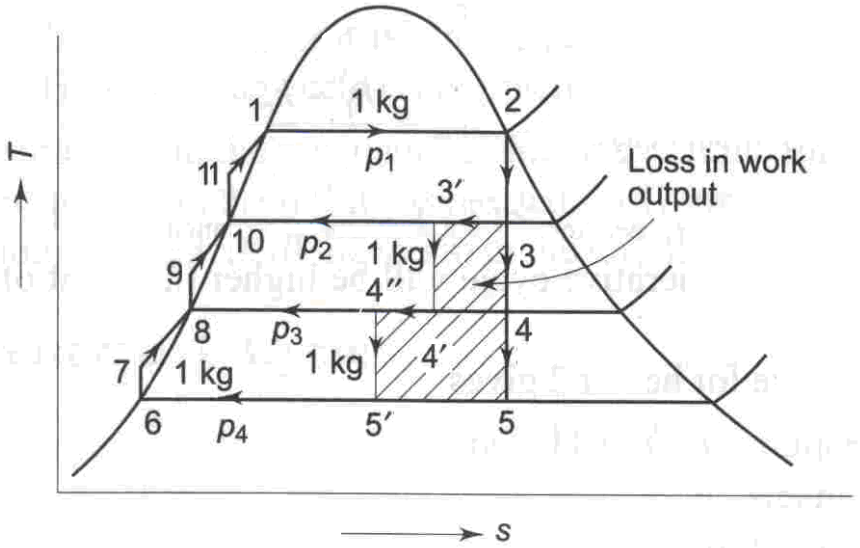

(b) Regenerative cycle on T-s plot for unit mass of fluid

We have $W_T = (h_2 - h_3) + (1 - m_1)(h_3 - h_4) + (1 - m_1 - m_2)(h_4 - h_5)$

$= (h_2 - h_3) + (h_3^1 - h_4^1) + (h_4^{11} - h_5^1)$ [From Figure b] --- (3)

The cycle $2 - 3 - 3^1 - 4^1 - 4^{11} - 5^1 - 6 - 7 - 8 - 9 - 10 - 11 - 2$ represents 1kg of working fluid. The heat released by steam condensing from 3 to 3^1 is utilized in heating up the water from 9 to 10.

$\therefore \quad 1 (h_3 - h_3^1) = 1 (h_{10} - h_9)$ --- (4)

Similarly, $1 (h_4^1 - h_4^{11}) = 1 (h_8 - h_7)$ --- (5)

GETMYUNI


From equation (3), (4) and (5),

$$W_T = (h_2 - h_5^1) - (h_3 - h_3^1) - (h_4^1 - h_4^{11})$$
$$= (h_2 - h_5^1) - (h_{10} - h_9) - (h_8 - h_7) \quad \text{--- (6)}$$

Also from Ideal regenerative cycle, [Previous article]

$$W_T = (h_2 - h_3^1) - (h_1^1 - h_1) \quad \text{--- (1)}$$

The similarity of equations (6) and equation (1) from previous article is notices. It is seen that the stepped cycle $2 - 3^1 - 4^1 - 4^{11} - 5^1 - 6 - 7 - 8 - 9 - 10 - 11$ approximates the ideal regenerative cycle in Figure (1) [previous article] and that a greater no. of stages would give a closer approximation. Thus the heating of feed water by steam 'bled' from the turbine, known as regeneration, "Carnotizes" the Rankine cycle.

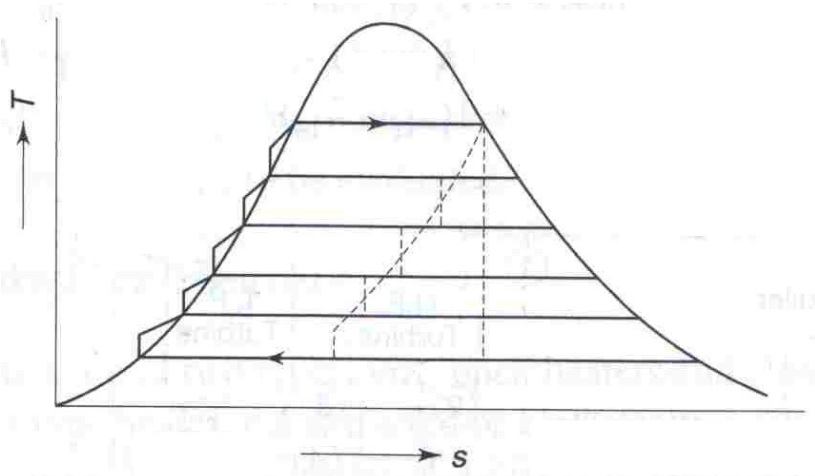

Regenerative cycle with many stages of feedwater heating

The heat rejected Q_L in the cycle decreases from $(h_5 - h_6)$ to $(h_5^1 - h_6)$. There is also loss in work output by the amount (area under $3 - 3^1$ + area under $4^1 - 4^{11}$ – area under $5 - 5^1$) as shown by the hatched area in Figure (b). So the steam rate increases by regeneration i.e., more steam has to circulate per hour to produce unit shaft output.

GETMYUNI

Reheat – Regenerative cycle:

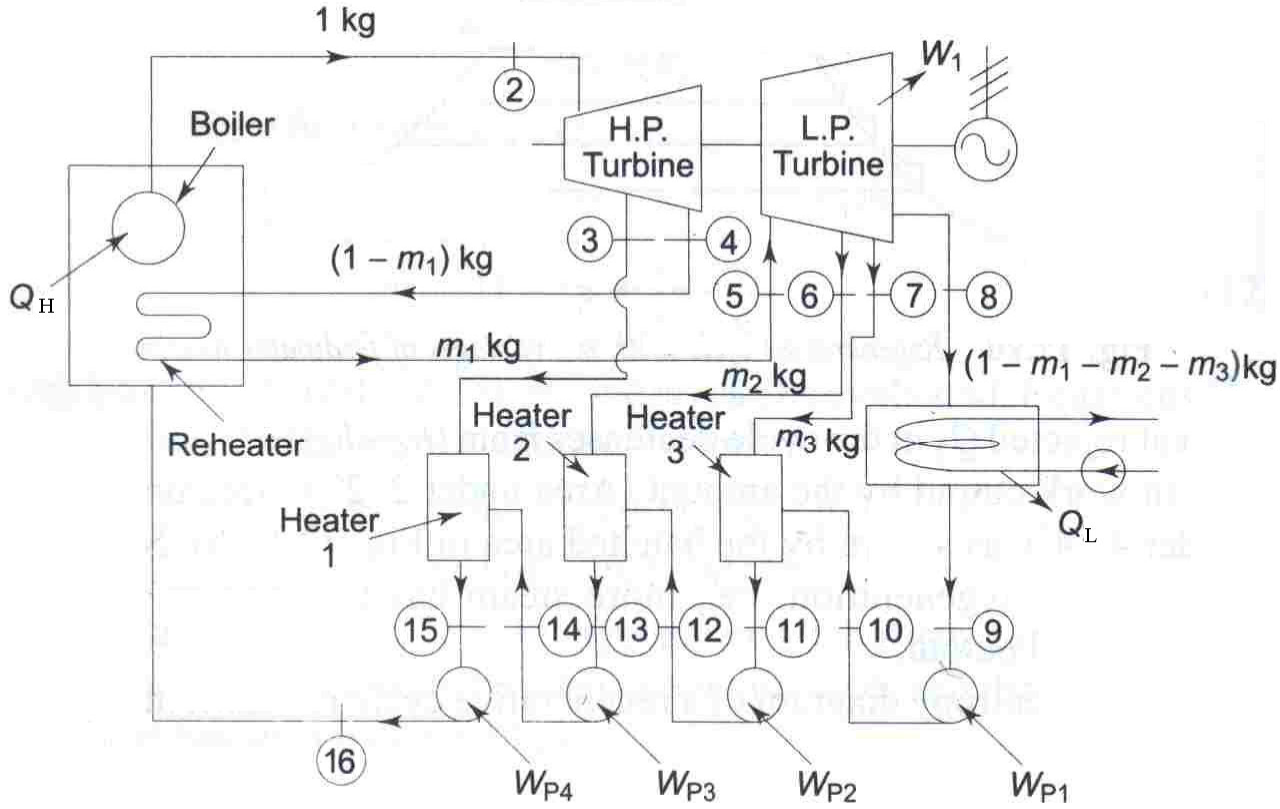


Fig. *Reheat-regenerative cycle flow diagram*

Reheat – regenerative cycle flow diagram (Three-stages of feed water heating)

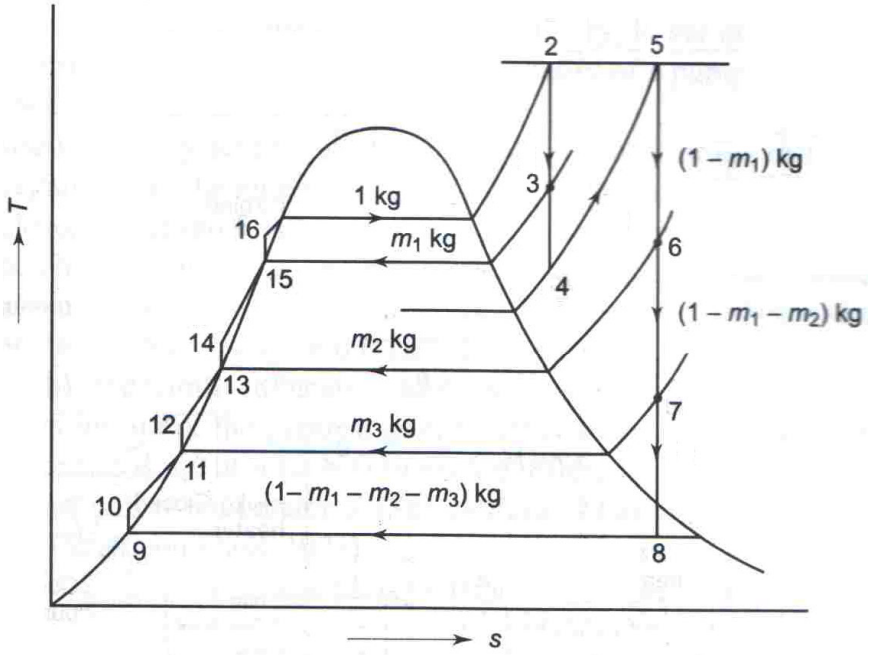


Fig. *T–s diagram of reheat-regenerative cycle*

GETMYUNI

The reheating of steam is employed when the vapourization pressure is high reheat alone on the thermal η is very small. ∴Regeneration or the heating up of feed water by steam extracted from the turbine will effect in more increasing in the η_{th}.

Turbine work, $W_T = (h_1 - h_2) + (1 - m_1)(h_2 - h_3) + (1 - m_1)(h_4 - h_5) + (1 - m_1 - m_2)(h_5 - h_6)$
$+ (1 - m_1 - m_2 - m_3)(h_6 - h_7)$ kJ/kg
Pump work, $W_P = (1 - m_1 - m_2 - m_3)(h_9 - h_8) + (1 - m_1 - m_2)(h_{11} - h_{10})$
$+ (1 - m_1)(h_{13} - h_{12}) + 1\,(h_{15} - h_{14})$ kJ/kg


Heat added, $Q_H = (h_1 - h_{15}) + (1 - m_1)(h_4 - h_3)$ kJ/kg
Heat rejected, $Q_L = (1 - m_1 - m_2 - m_3)(h_7 - h_8)$ kJ/kg

The energy balance of heaters 1, 2 and 3 gives
$m_1 h_2 + (1 - m_1) h_{13} = 1 \times h_{14}$
$m_2 h_5 + (1 - m_1 - m_2) h_{11} = (1 - m_1) h_{12}$
$m_3 h_6 + (1 - m_1 - m_2 - m_3) h_9 = (1 - m_1 - m_2) h_{10}$
From which m_1, m_2 and m_3 can be evaluated

Numerical Problems:

1. **An ideal reheat cycle utilizes steam as the working fluid. Steam at 100 bar, 400^{0}C is expanded in the HP turbine to 15 bar. After this, it is reheated to 350^{0}C at 15 bar and is then expanded in the LP turbine to the condenser pressure of 0.5 bar. Determine the thermal η and steam rate.**

Solution:

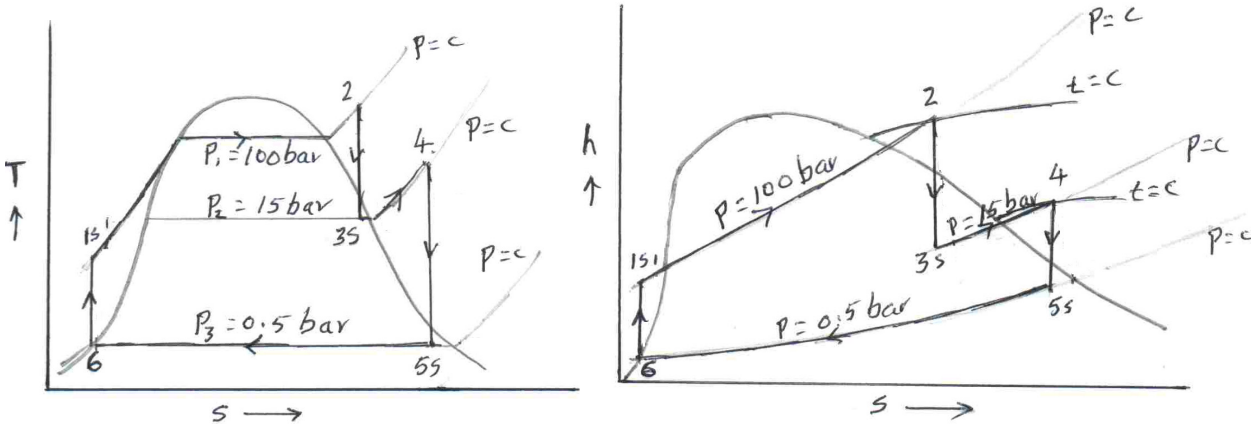

From steam tables
P = 100 bar t = 400^{0}C = v = 0.026408m^3/kg
h = 3099.9 kJ/kg
S = 6.2182 kJ/kg-K

P = 15 bar t_S = 192.28^{0}C, v_f = 0.0011538m^3/kg, v_g = 0.13167m^3/kg
h_f = 844.6 kJ/kg, h_{fg} = 1845.3 kJ/kg, h_g = 2789.9 kJ/kg
s_f = 2.3144kJ/kg-K, s_{fg} = 4.1262 kJ/kg-K, s_g = 6.4406 kJ/kg-K

GETMYUNI

P = 0.5 bar $t_S = 81.35^0C$, $v_f = 0.0010301\ m^3/kg$, $v_g = 3.2401\ m^3/kg$
$h_f = 340.6$ kJ/kg, $h_{fg} = 2305.4$ kJ/kg $h_g = 2646.0$ kJ/kg
$s_f = 1.0912$ kJ/kg-K $s_{fg} = 6.5035$ kJ/kg-K, $s_g = 7.5947$ kJ/kg-K

$h_2 = 3099.9$ kJ/kg,
Process 2-3s is isentropic, i.e., $S_2 = S_{3S}$

$$6.2182 = 2.3144 + x_{3S}\,(4.1262)$$
$$\therefore x_{3S} = 0.946$$
$$\therefore h_{3S} = 844.6 + x_{3S}\,(1845.3)$$
$$= 2590.44 \text{ kJ/kg}$$

$\therefore$ Expansion of steam in the HP turbine $= h_2 - h_{3S}$
$= 3099.9 - 2590.44$
$= 509.46$ kJ/kg

P = 15 bar, $t = 350^0C$ = $v = 0.18653$
$h = 3148.7$
$s = 7.1044$

Expansion of steam in the LP cylinder = $h_4 - h_{5s}$
$h_4 = 3148.7$ kJ/kg
To find h_{5s}:
We have $S_4 = S_{5s}$

$$7.1044 = S_{f5} + x_{5S}\,S_{fg5}$$
$$= 1.0912 + x_{5S}\,(6.5035)$$
$$\therefore x_{5S} = 0.925$$

$\therefore h_{5s} = 340.6 + 0.925\,(2305.4) = 2473.09$ kJ/kg
$\therefore$ Expansion of steam in the LP turbine $= 3148.7 - 2473.09$
$= 675.61$ kJ/kg


$h_6 = h_f$ for P_3 =0.5 bar i.e., $h_6 = 340.6$ kJ/kg
Pump work, $W_P = h_{1s} - h_6$ $= v_{f5}\,(P_3 - P_1) = 0.0010301\,(100 - 0.501 \times 10^5)$
$= 10.249$ kJ/kg
$\therefore h_{1s} = 350.85$ kJ/kg
$\therefore$ Heat supplied, Q_H $= (h_2 - h_{1S}) + (h_4 - h_{3S})$
$= (3099.9 - 350.85) + (3148.7 - 2590.44)$
$= 2749.05$ kJ/kg + 558.26
$= 3307.31$ kJ/kg

$$\therefore \quad \eta_{th} = \frac{W_{net}}{Q_H} = \frac{(W)_{HP} + (W)_{LP} - W_P}{Q_H}$$
$$= \frac{509.46 + 675.61 - 10.25}{3307.31} = 0.355$$

$$\text{Steam rate, SSC} = \frac{3600}{W_{net}} = 3.064 kg/kWh$$

GETMYUNI

1. b) When η of the HP turbine, LP turbine and feed pump are 80%, 85% and 90% respectively.

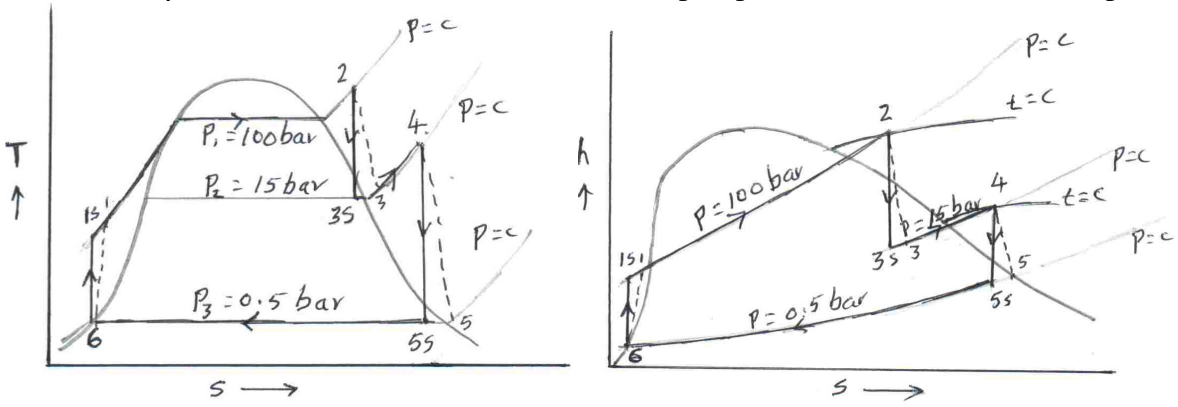

$$\eta_{tHP} = \frac{h_2 - h_3}{h_2 - h_{3s}} = 0.8 = \frac{3099.9 - h_3}{3099.9 - 2590.44}$$

$\therefore h_3 = 2692.33$ kJ/kg

$$\eta_{tLP} = \frac{h_4 - h_5}{h_4 - h_{5s}} = 0.85 = \frac{3148.7 - h_5}{3148.7 - 2473.09}$$

$\therefore h_5 = 2574.43$ kJ/kg

$$\eta_P = \frac{h_{15} - h_6}{h_1 - h_6} = 0.9 = \frac{350.85 - 340.6}{h_1 - 340.6}$$

$\therefore h_1 = 351.99$ kJ/kg

$$\therefore \eta_{th} = \frac{(h_2 - h_3) + (h_4 - h_5) - (h_1 - h_6)}{(h_2 - h_1) + (h_4 - h_3)}$$

$$= \frac{(3099.9 - 2692.33) + (3148.7 - 2574.43) - (351.99 - 340.6)}{(3099.9 - 351.99) + (3148.7 - 2692.33)}$$

$= 0.303$ or 30.3%

$\therefore$ SSC = 3.71 kg/kWh


Using Mollier-chart: $h_2 = 3095$ kJ/kg, $h_{3s} = 2680$ kJ/kg, $h_4 = 3145$ kJ/kg
$h_5 = 2475$ kJ/kg, $h_6 = 340.6$ kJ/kg (from steam tables)
$W_P = 10.249$ kJ/kg

2. Steam at 50 bar, 350^{0}C expands to 12 bar in a HP stage, and is dry saturated at the stage exit. This is now reheated to 280^{0}C without any pressure drop. The reheat steam expands in an intermediate stage and again emerges dry and saturated at a low pressure, to be reheated a second time to 280^{0}C. Finally, the steam expands in a LP stage to 0.05 bar. Assuming the work output is the same for the high and intermediate

GETMYUNI

stages, and the efficiencies of the high and low pressure stages are equal, find: (a) η of the HP stage (b) Pressure of steam at the exit of the intermediate stage, (c) Total power output from the three stages for a flow of 1kg/s of steam, (d) Condition of steam at exit of LP stage and (e) Then η of the reheat cycle. Also calculate the thermodynamic mean temperature of energy addition for the cycle.

Solution:

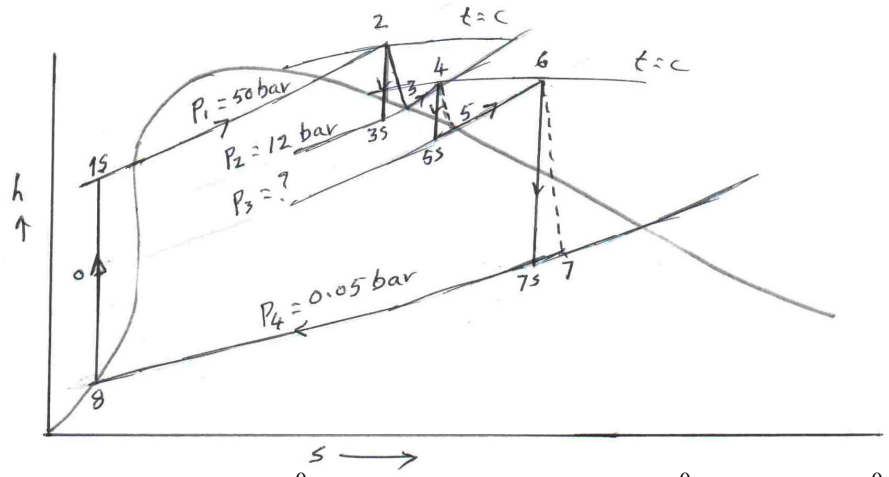

$P_1 = 50$ bar $\quad t_2 = 350^0$C $\quad P_2 = 12$ bar $\quad t_4 = 280^0$C, $\quad t_6 = 280^0$C

$P_3 = ?$ $\quad P_4 = 0.05$ bar

From Mollier diagram

$h_2 = 3070$kJ/kg $\quad h_{3s} = 2755$ kJ/kg $\quad h_3 = 2780$ kJ/kg $\quad h_4 = 3008$ kJ/kg

(a) η_t for HP stage $= \dfrac{h_2 - h_3}{h_2 - h_{3s}} = \dfrac{3070 - 2780}{3070 - 2755}$

$= 0.921$

(b) Since the power output in the intermediate stage equals that of the HP stage, we have

$h_2 - h_3 = h_4 - h_5$

i.e., $3070 - 2780 = 3008 - h_5$

$\therefore h_5 = 2718$ kJ/kg

Since state 5 is on the saturation line, we find from Mollier chart, $P_3 = 2.6$ bar,
Also from Mollier chart, $h_{5s} = 2708$ kJ/kg, $h_6 = 3038$ kJ/kg, $h_{7s} = 2368$ kJ/kg

Since η_t is same for HP and LP stages,

$$\eta_t = \frac{h_6 - h_7}{h_6 - h_{7s}} = 0.921 = \frac{3038 - h_7}{3038 - 2368} \quad \therefore h_7 = 2420.93\text{kJ/kg}$$

$\therefore$ At a pressure 0.05 bar, $h_7 = h_{f7} + x_7 h_{fg7}$

$2420.93 = 137.8 + x_7 (2423.8)$

$\therefore x_7 = 0.941$

Total power output $= (h_2 - h_3) + (h_4 - h_5) + (h_6 - h_7)$

$= (3070 - 2780) + (3008 - 2718) + (3038 - 2420.93)$

$= 1197.07$ kJ/kg

GETMYUNI

$\therefore$ Total power output /kg of steam = 1197.07 kW

For P_4 = 0.05 bar from steam tables, h_8 = 137.8 kJ/kg;

$W_P = 0.0010052\ (50 - 0.05)\ 10^2 = 5.021$ kJ/kg

$= h_8 - h_{1s}$

$\therefore h_{1s} = 142.82$ kJ/kg

Heat supplied, Q_H $= (h_2 - h_{1s}) + (h_4 - h_3) + (h_6 - h_5)$

$= (3070 - 142.82) + (3008 - 2780) + (3038 - 2718)$

$= 3475.18$ kJ/kg

$W_{net} = W_T - W_P = 1197.07 - 5.021 = 1192.05$ kJ/kg

$$\therefore \eta_{th} = \frac{W_{net}}{Q_H} = \frac{1192.05}{3475.18} = 0.343$$

$$\eta_{th} = 1 - \frac{T_o}{T_m} = 1 - \frac{(273 + 32.9)}{T_m} = 0.343,$$

$$0.657 = \frac{305.9}{T_m}$$

$\therefore T_m = 465.6$ K


Or

$$T_m = \frac{h_2 - h_{1s}}{S_2 - S_{1s}} = \frac{3070 - 142.82}{6.425 - 0.4763} = 492K$$

$$SSC = \frac{3600}{1192.05} = 3.02 kg/kWh$$

3. A steam power station uses the following cycle: Steam at boiler outlet – 150 bar; reheat at 40 bar, 550^{0}C; condenser at 0.1 bar. Using Mollier chart and assuming that all processes are ideal, find (i) quality at turbine exhaust (ii) cycle η (iii) steam rate.

Solution:

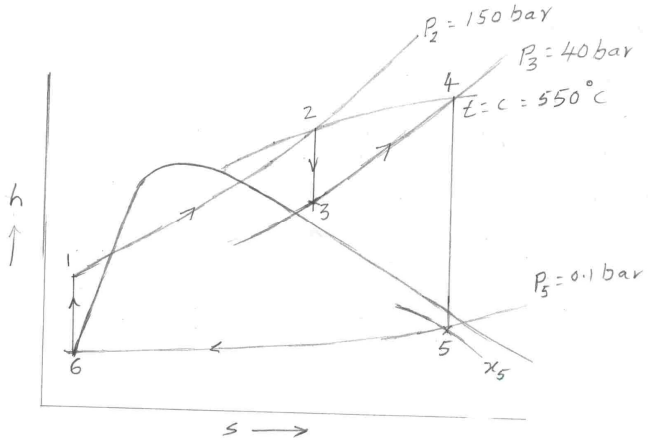

GETMYUNI

P_2 = 150 bar $t_2 = 550^0C$ P_3 = 40 bar $t_3 = 550^0C$

P_5 = 0.1 bar

From Mollier diagram i.e., h-s diagram

$$h_2 = h\Big|_{150bar,550^0C} = 3450kJ/kg$$

$$h_4 = h\Big|_{40bar,550^0C} = 3562kJ/kg$$

h_3 = 3050 kJ/kg

h_5 = 2290 kJ/kg

x_5 = 0.876 kJ/kg

h_6 can not determined from h-s diagram, hence steam tables are used.

$$h_6 = h_f\Big|_{0.1bar} = 191.8kJ/kg$$

Process 6-1 is isentropic pump work i.e., $W_{P1} = v\int dP$

$= 0.0010102\ (40 - 01)\ 10^5/10^3 = 4.031$ kJ/kg

$= (h_1 - h_6)$

$\therefore h_1 = 195.8$ kJ/kg

(i) Quality of steam at turbine exhaust = $x_5 = 0.876$

$$(ii)\ \eta_{cycle} = \frac{W_T - W_P}{Q_H}$$

Turbine work, W_T $= W_{T1} + W_{T2}$

$= (h_2 - h_3) + (h_4 - h_5)$

$= (3450 - 3050) + (3562 - 2290)$

$= 1672$ kJ/kg

$Q_H = Q_1 + Q_R = (h_2 - h_1) + (h_4 - h_3)$

GETMYUNI

$= (3450 - 195.8) + (3562 - 3050)$


$= 3766.2$ kJ/kg

$$\therefore \eta_{cycle} = \frac{1672 - 4.031}{3766.2} = \frac{1667.97}{3766.2} = 0.443$$

$$(iii) \quad Steam\ rate = \frac{3600}{1667.97} = 2.16 kg/kWh$$

4. An ideal Rankine cycle with reheat is designed to operate according to the following specification. Pressure of steam at high pressure turbine = 20 MPa, Temperature of steam at high pressure turbine inlet = 550^{0}C, Temperature of steam at the end of reheat = 550^{0}C, Pressure of steam at the turbine exhaust = 15 KPa. Quality of steam at turbine exhaust = 90%. Determine (i) the pressure of steam in the reheater (ii) ratio of pump work to turbine work, (iii) ratio of heat rejection to heat addition, (iv) cycle η.

Solution:

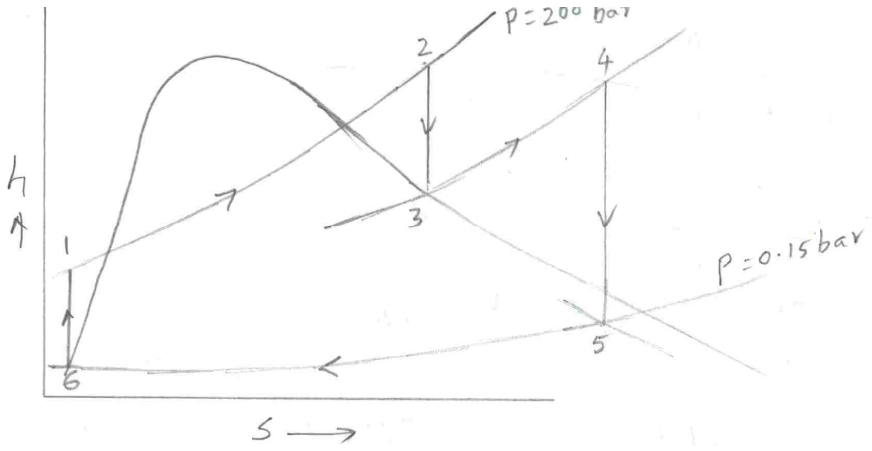

$P_2 = 200$ bar $\quad t_2 = 550^0$C $\quad t_4 = 550^0$C $\quad P_5 = 0.15$ bar $\quad x_5 = 0.9$

From Mollier diagram,

$h_2 = 3370$ kJ/kg

$h_3 = 2800$ kJ/kg

$h_4 = 3580$ kJ/kg

$h_5 = 2410$ kJ/kg

$x_5 = 0.915$

$P_3 = P_4 = 28$ bar

GETMYUNI

But given in the data $x_5 = 0.9$

From steam tables $h_6 = 226$ kJ/kg

Pump work $W_P = v\int dP$

$= 0.001014\ (200 - 0.15)\ 10^5/10^3$

$= 20.26$ kJ/kg

But $W_P = h_1 - h_6$ $\quad \therefore h_1 = 246.26$ kJ/kg

(i) Pressure of steam in the reheater = 28 bar

(ii) Turbine work $W_T = (h_2 - h_3) + (h_4 - h_5)$

$= (3370 - 2800) + (3580 - 2410)$

$= 1740$ kJ/kg

$\therefore$ Ratio of $\frac{W_P}{W_T} = 0.0116$ *i.e.*, 1.2%

(iii) $Q_L = (h_5 - h_6) = (2410 - 226) = 2184$ kJ/kg

$Q_H = (h_2 - h_1) + (h_4 - h_3)$

$= (3370 - 226) + (3580 - 2800)$

$= 3924$ kJ/kg

$\therefore \frac{Q_L}{Q_H} = 0.5565$ *i.e.*, 55.65%

$(iv)\ \eta_{cycle} = \frac{W_{net}}{Q_{Total}} = \frac{(1740 - 20.26)}{3924} = 0.4383$ *i.e.*, 43.8%

GETMYUNI

Feedwater Heaters (FWH)

A practical Regeneration process in steam power plants is accomplished by extracting or bleeding, steam from the turbine at various points. This steam, which could have produced more work by expanding further in the turbine, is used to heat the feed water instead. The device where the feedwater heated by regeneration is called a Regenerator or a Feedwater Heater (FWH).

A feedwater heater is basically a heat exchanger where heat is transferred from the steam to the feedwater either by mixing the two streams (open feedwater heaters) or without mixing them (closed feedwater heaters).

Open Feedwater Heaters

An open (or direct-contact) feedwater heater is basically a mixing chamber, where the steam extracted from the turbine mixes with the feedwater exiting the pump. Ideally, the mixture leaves the heater as a saturated liquid at the heater pressure.

The advantages of open heater are simplicity, lower cost, and high heat transfer capacity. The disadvantage is the necessity of a pump at each heater to handle the large feedwater stream.

Closed Feedwater Heaters

In closed feedwater heater, the heat is transferred from the extracted steam to the feedwater without mixing taking place. The feedwater flows through the tubes in the heater and extracted steam condenses on the outside of the tubes in the shell. The heat released from the condensation is transferred to the feedwater through the walls of the tubes. The condensate (saturated water at the steam extraction pressure), some times called the heater-drip, then passes through a trap into the next lower pressure heater. This, to some extent, reduces the steam required by that heater. The trap passes only liquid and no vapour. The drip from the lowest pressure heater could similarly be trapped to the condenser, but this would be throwing away energy to the condenser cooling water. The avoid this waste, the drip pump feed the drip directly into the feedwater stream.

A closed heaters system requires only a single pump for the main feedwater stream regardless of the number of heaters. The drip pump, if used is relatively small. Closed heaters are costly and may not give as high a feedwater temperature as do open heaters.

In most steam power plants, closed heaters are favoured, but atleast one open heater is used, primarily for the purpose of feedwater deaeration. The open heater in such a system is called deaerator.

Note: The higher the number of heater used, the higher will be the cycle efficiency. The number of heater is fixed up by the energy balance of the whole plant when it is found that the cost of adding another does not justify the saving in Q_H or the marginal increase in cycle efficiency. An

GETMYUNI

increase in feedwater temperature may, in some cases, cause a reduction in boiler efficiency. So the number of heaters get optimized. Five feedwater heaters are often used in practice.

Characteristics of an Ideal working fluid

The maximum temperature that can be used in steam cycles consistent with the best available material is about 600^0C, while the critical temperature of steam is 375^0C, which necessitates large superheating and permits the addition of only an infinitesimal amount of heat at the highest temperature.

The desirable characteristics of the working fluid in a vapour power cycle to obtain best thermal η are as follows:

a) The fluid should have a high critical temperature so that the saturation pressure at the maximum permissible temperature (metallurgical limit) is relatively low. It should have a large enthalpy of evaporation at that pressure.
b) The saturation pressure at the temperature of heat rejection should be above atmosphere pressure so as to avoid the necessity of maintaining vacuum in the condenser.
c) The specific heat of liquid should be small so that little heat transfer is required to raise the liquid to the boiling point.
d) The saturation vapour line of the T-S diagram should be steep, very close to the turbine expansion process so that excessive moisture does not appear during expansion.
e) The freezing point of the fluid should be below room temperature, so that it does not get solidified while flowing through the pipe lines.
f) The fluid should be chemically stable and should not contaminate the materials of construction at any temperature.
g) The fluid should be nontoxic, non corrosive, not excessively viscous, and low in cost.

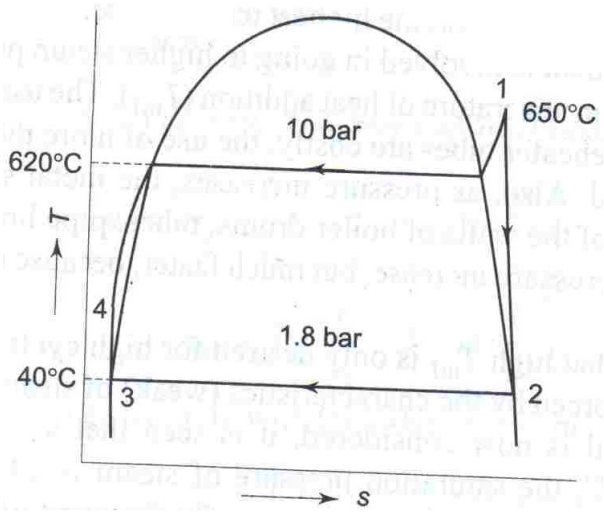



Fig. T-S diagram for an Ideal Working Fluid for a Vapour Power Cycle

GETMYUNI

Numerical Problems:

1. **An ideal regenerative cycle operates with dry saturated steam, the maximum and minimum pressures being 30 bar and 0.04 bar respectively. The plant is installed with a single mixing type feed water heater. The bled steam pressure is 2.5 bar. Determine (a) the mass of the bled steam, (b) the thermal η of the cycle, and (c) SSC in kg/kWh.**

Solution:

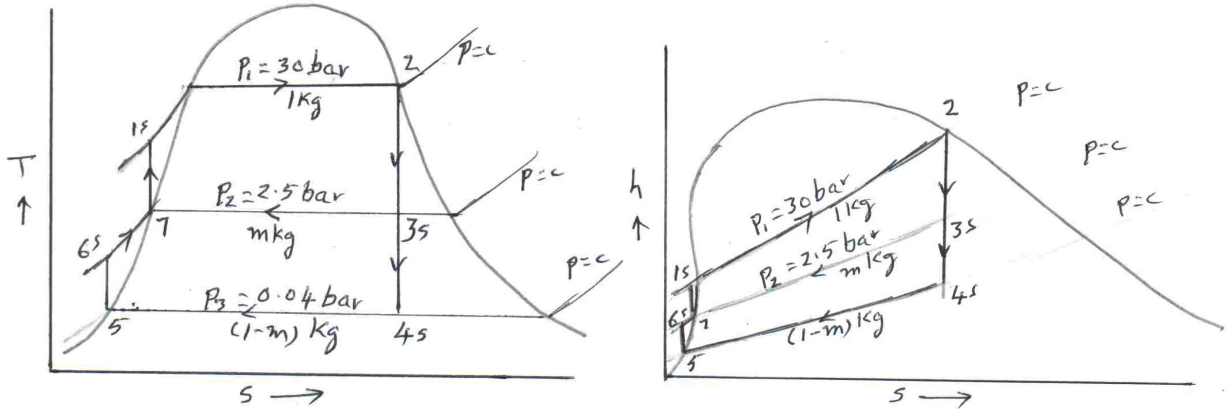

$P_1 = 30$ bar $\quad P_2 = 2.5$ bar $\quad P_3 = 0.04$ bar

From steam tables, For $P_1 = 30$ bar, $\quad h_2 = 2802.3$ kJ/kg, $\quad S_2 = 6.1838$ kJ/kg-^{0}k

But $S_2 = S_{3s}$ i.e., $6.1838 = 1.6072 + x_3\ (5.4448)$

$\therefore x_3 = 0.841$

$\therefore h_3 = 535.4 + 0.841\ (2281.0)$

$= 2452.68$ kJ/kg

Also $S_2 = S_{4s}$ i.e., $6.1838 = 0.4225 + x_4\ (8.053)$

$\therefore x_4 = 0.715$

$\therefore h_4 = 121.4 + 0.715\ (2433.1)$

$= 1862.1$ kJ/kg

At $P_3 = 0.04$ bar, $\quad h_5 = 121.4$ kJ/kg, $\quad v_5 = 0.001004$ m^3/kg

$\therefore$ Condensate pump work $= (h_6 - h_5) = v_5\ (P_2 - P_3)$

$= 0.001004\ (2.5 - 0.04)\ (10^5/10^3)$

$= 0.247$ kJ/kg

$\therefore h_6 = 0.247 + 121.4 = 121.65$ kJ/kg

Similarly, $h_1 = h_7 + v_7\ (P_1 - P_2)\ (10^5/10^3)$

$= 535.4 + 0.0010676\ (30 - 2.5)\ 10^2$

$= 538.34$ kJ/kg

GETMYUNI

a) **Mass of the bled steam:**

Applying the energy balance to the feed water heater

$mh_3 + (1 - m)\, h_6 = 1\,(h_7)$

$$\therefore m = \frac{(h_7 - h_6)}{(h_3 - h_6)} = \frac{(535.4 - 121.65)}{(2452.68 - 121.65)} = 0.177 kg/kg \text{ of steam}$$

b) **Thermal η:**

Turbine work, $W_T = 1\,(h_2 - h_{3s}) + (1 - m)\,(h_3 - h_{4s})$
$= 1\,(2802.3 - 2452.65) + (1 - 0.177)\,(2452.68 - 1862.1)$
$= 835.67$ kJ/kg

Pump work, $W_P = (1 - m)\,(h_{6s} - h_5) + 1\,(h_{1s} - h_7)$
$= (1 - 0.177)\,(121.65 - 121.4) + 1\,(538.34 - 535.4)$
$= 3.146$ kJ/kg

$\therefore W_{net} = W_T - W_P = 832.52$ kJ/kg

Heat supplied, $Q_H = 1\,(h_2 - h_{1s})$
$= 1\,(2802.3 - 538.34)$
$= 2263.96$ kJ/kg

$$\therefore \eta_{th} = \frac{W_{net}}{Q_H} = \frac{832.52}{2263.96} = 0.368 \text{ or } \mathbf{36.8\%}$$

c) **SSC:**

$$SSC = \frac{3600}{W_{net}} = 4.324 kg/kWh$$

2. In problem (3), also calculate the increase in mean temperature of heat addition, efficiency and steam rate as compared to the Rankine cycle (without regeneration)

Solution: Tm_1 (with regeneration) $= \frac{h_2 - h_1}{S_2 - S_1} = \frac{2263.96}{(6.1838 - 1.6072)} = 494.68k$

Tm_1 (without regeneration) $= \frac{h_2 - h_6}{S_2 - S_6} = \frac{2802.3 - 121.65}{(6.1838 - 0.4225)} = 465.29k$

$\therefore$ Increase in Tm_1 due to regeneration = 494.68 – 465.29 = **29.39^0K**

W_T (without regeneration) = $h_2 - h_4 = 2802.3 - 1862.1 = 940.2$ kJ/kg

W_P (without regeneration) = $(h_1 - h_5) = v_5\,(30 - 0.04)\,10^2$
$= 0.001004\,(29.96)\,10^2 = 3.01$ kJ/kg

$\therefore h_1 = 3.01 + 121.4 = 124.41$ kJ/kg

GETMYUNI

$\therefore \eta_{th}$ (without regeneration) $= \dfrac{W_{net}}{Q_H} = \dfrac{(940.2 - 3.01)}{2802.3 - 124.41} = 0.349$


$\therefore$ Increase in η_{th} due to regeneration = 0.368 – 0.349 = 0.018 i.e., 1.8%

Steam rate (without regeneration) = 3.84 kg/kWh

$\therefore$ Increase in steam rate due to regeneration = 4.324 – 3.84
= 0.484 kg/kWh

3. Steam at 20 bar and 300^{0}C is supplied to a turbine in a cycle and is bled at 4 bar. The bled-steam just comes out saturated. This steam heats water in an open heater to its saturation state. The rest of the steam in the turbine expands to a condenser pressure of 0.1 bar. Assuming the turbine efficiency to be the same before and after bleeding, find: a) the turbine η and the steam quality at the exit of the last stage; b) the mass flow rate of bled steam 1kg of steam flow at the turbine inlet; c) power output / (kg/s) of steam flow; and d) overall cycle η.

Solution:

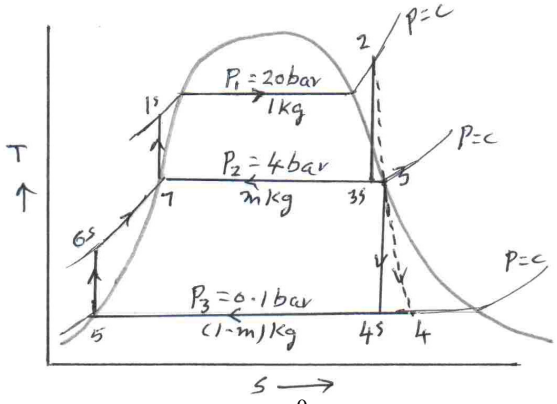

P_1 = 20 bar $t_1 = 300^0$C P_2 = 4 bar P_3 = 0.1 bar

From steam tables,

For P_1 = 20 bar and $t_1 = 300^0$C

v_2 = 0.12550 h_2 = 3025.0 S_2 = 6.7696

For P_2 = 4 bar, h_3 = 2737.6, t_s = 143.63

h_f = 604.7, h_{fg} = 2132.9, S_f = 1.7764, S_{fg} = 5.1179, S_g = 6.8943

For P_2 = 0.1 bar, 45.83, 191.8, 2392.9, 2584.8, 0.6493, 7.5018, 8.1511

We have, $S_2 = S_{3s}$ i.e., 6.7696 = 1.7764 + x_3 (5.1179)

$\therefore x_3 = 0.976$

$\therefore h_{3s}$ = 604.7 + 0.976 (2132.9) = 2685.63 kJ/kg

$$\therefore \eta_t = \frac{h_2 - h_3}{h_2 - h_{3s}} = \frac{3025 - 2737.6}{3025 - 2685.63} = 0.847$$

$S_3 = S_{4s}$ i.e., 6.8943 = 0.6493 + x_4 (7.5018)

$\therefore x_{4s} = 0.832$

GETMYUNI

$\therefore h_{4s} = 191.8 + 0.832\ (2392.9) = 2183.81 kJ/kg$

But η_t is same before and after bleeding i.e., $\eta_t = \dfrac{h_3 - h_4}{h_3 - h_{4s}}$

$$\text{i.e., } 0.847 = \frac{2737.6 - h_4}{2737.6 - 2183.81}$$

$$\therefore h_4 = 2268.54 \text{ kJ/kg}$$

$\therefore h_4 = h_{f4} + x_4\ h_{fg4}$ $\quad \therefore x_4 = 0.868$

b) Applying energy balance to open heater, $mh_3 + (1 - m)\ h_{6s} = 1\ (h_7)$

$$\therefore m = \frac{h_7 - h_6}{h_3 - h_6}$$

Condensate pump work, $(h_{6s} - h_5) = v_5\ (P_3 - P_2)$

$= 0.0010102\ (3.9)\ 10^2 = 0.394$ kJ/kg

$\therefore h_{6s} = 191.8 + 0.394 = 192.19$ kJ/kg

Similarly, h_{1s} $= h_7 + v_7\ (P_1 - P_2)$

$= 604.7 + -.0010839\ (16)\ 10^2 = 606.43$ kJ/kg

$$\therefore m = \frac{604.7 - 192.19}{2737.6 - 192.19} = 0.162$$

c) Power output or $W_T = (h_2 - h_3) + (1 - m)\ (h_3 - h_4)$

$= (3025 - 2737.6) + (1 - 0.162)\ (2737.6 - 2268.54)$

$= 680.44$ kJ/kg

For 1kg/s of steam, $\quad W_T = 680.44$ kW

d) Overall thermal efficiency, $\eta_0 = \dfrac{W_{net}}{Q_H}$

W_P $= (1 - m)\ (h_{6s} - h_5) + 1\ (h_{1s} - h_7)$

$= (1 - 0162)\ (192.19 - 191.8) + 1\ (606.43 - 604.7)$

$= 2.057$ kJ/kg


$W_{net} = 680.44 - 2.057 = 678.38$ kJ/kg

$Q_H = 1\ (h_2 - h_{1s}) = (3025 - 606.43) = 2418.57$ kJ/kg

$$\therefore \eta_0 = \frac{678.38}{2418.57} = 0.2805$$


GETMYUNI

Using Moiller Diagram

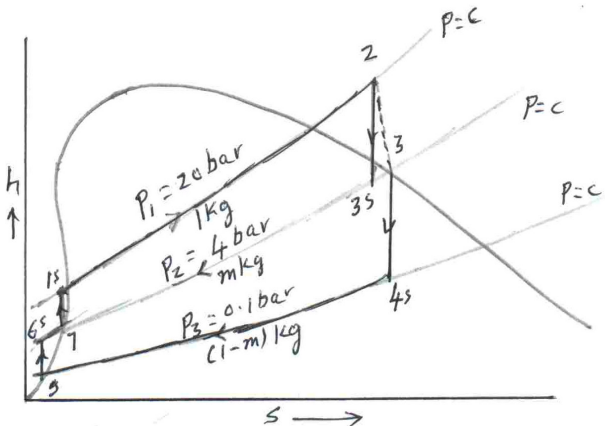

4. **Steam at 50 bar, 350^{0}C expands to 12 bar in a HP stage, and is dry saturated at the stage exit. This is now reheated to 280^{0}C without any pressure drop. The reheat steam expands in an intermediate stage and again emerges dry and saturated at a low pressure, to be reheated a second time to 280^{0}C. Finally, the steam expands in a LP stage to 0.05 bar. Assuming the work output is the same for the high and intermediate stages, and the efficiencies of the high and low pressure stages are equal, find: (a) η of the HP stage (b) Pressure of steam at the exit of the intermediate stage, (c) Total power output from the three stages for a flow of 1kg/s of steam, (d) Condition of steam at exit of LP stage and (e) Then η of the reheat cycle. Also calculate the thermodynamic mean temperature of energy addition for the cycle.**

Solution:

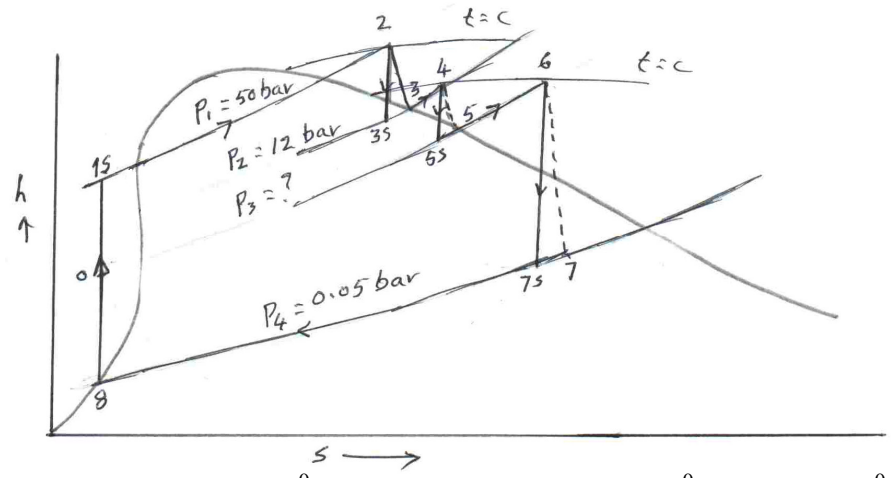

P_1 = 50 bar t_2 = 350^{0}C P_2 = 12 bar t_4 = 280^{0}C, t_6 = 280^{0}C

P_3 = ? P_4 = 0.05 bar

From Mollier diagram

h_2 = 3070kJ/kg h_{3s} = 2755 kJ/kg h_3 = 2780 kJ/kg h_4 = 3008 kJ/kg

(a) η_t for HP stage $= \dfrac{h_2 - h_3}{h_2 - h_{3s}} = \dfrac{3070 - 2780}{3070 - 2755}$

GETMYUNI

= 0.921

(b) Since the power output in the intermediate stage equals that of the HP stage, we have

$h_2 - h_3 = h_4 - h_5$

i.e., $3070 - 2780 = 3008 - h_5$

$\therefore h_5 = 2718$ kJ/kg

Since state 5 is on the saturation line, we find from Mollier chart, $P_3 = 2.6$ bar,
Also from Mollier chart, $h_{5s} = 2708$ kJ/kg, $h_6 = 3038$ kJ/kg, $h_{7s} = 2368$ kJ/kg

Since η_t is same for HP and LP stages,

$$\eta_t = \frac{h_6 - h_7}{h_6 - h_{7s}} = 0.921 = \frac{3038 - h_7}{3038 - 2368} \quad \therefore h_7 = 2420.93 \text{kJ/kg}$$

$\therefore$ At a pressure 0.05 bar, $h_7 = h_{f7} + x_7 h_{fg7}$

$2420.93 = 137.8 + x_7 (2423.8)$

$\therefore x_7 = 0.941$

Total power output $= (h_2 - h_3) + (h_4 - h_5) + (h_6 - h_7)$
$= (3070 - 2780) + (3008 - 2718) + (3038 - 2420.93)$
$= 1197.07$ kJ/kg

$\therefore$ Total power output /kg of steam = 1197.07 kW

For $P_4 = 0.05$ bar from steam tables, $h_8 = 137.8$ kJ/kg;

$W_P = 0.0010052 (50 - 0.05) 10^2 = 5.021$ kJ/kg

$= h_8 - h_{1s}$

$\therefore h_{1s} = 142.82$ kJ/kg

Heat supplied, $Q_H = (h_2 - h_{1s}) + (h_4 - h_3) + (h_6 - h_5)$
$= (3070 - 142.82) + (3008 - 2780) + (3038 - 2718)$
$= 3475.18$ kJ/kg

$W_{net} = W_T - W_P = 1197.07 - 5.021 = 1192.05$ kJ/kg

$$\therefore \eta_{th} = \frac{W_{net}}{Q_H} = \frac{1192.05}{3475.18} = 0.343$$

$$\eta_{th} = 1 - \frac{T_o}{T_m} = 1 - \frac{(273 + 32.9)}{T_m} = 0.343,$$

$$0.657 = \frac{305.9}{T_m}$$

$\therefore T_m = 465.6$ K

Or


$$T_m = \frac{h_2 - h_{1s}}{S_2 - S_{1s}} = \frac{3070 - 142.82}{6.425 - 0.4763} = 492K$$

GETMYUNI

$$SSC = \frac{3600}{1192.05} = 3.02 kg / kWh$$

5. Steam at 30 bar and 350^{0}C is supplied to a steam turbine in a practical regenerative cycle and the steam is bled at 4 bar. The bled steam comes out as dry saturated steam and heats the feed water in an open feed water heater to its saturated liquid state. The rest of the steam in the turbine expands to condenser pressure of 0.1 bar. Assuming the turbine η to be same before and after bleeding determine (i) the turbine η, (ii) steam quality at inlet to condenser, (iii) mass flow rate of bled steam per unit mass rate at turbine inlet and (iv) the cycle η.

Solution:

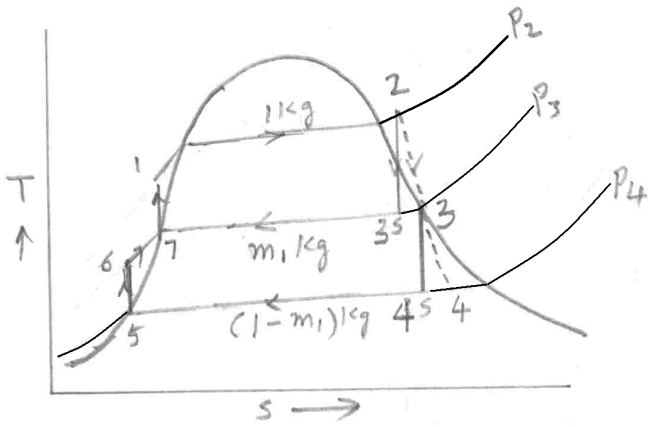

P_2 = 30 bar t_2 = 350^{0}C P_3 = 4 bar P_4 = 0.1 bar

$h_3 = h_g$ at P_3 = 4 bar, = 2737.6 kJ/kg

From superheated steam tables,

$$h_2 = h_3 = h_g\Big|_{P_3=4bar} = 2737.6\ kJ/kg$$

$$h_2 = h\Big|_{P_2=30bar\ \&\ t_2=350^0 C} = 3117.5\ kJ/kg \text{ and } \quad S_2 = 6.7471 \text{ kJ/kg-K}$$

$$h_5 = h_f\Big|_{P_5=0.1bar} = 191.8\ kJ/kg$$

GETMYUNI

$h_7 = h_f\big|_{P_7=4bar} = 604.7\ kJ/kg$

Process 2-3s is isentropic, i.e., $S_2 = S_{3S}$

$$6.7471 = 1.7764 + x_{3S}\,(5.1179)$$

$$\therefore x_{3S} = 0.971$$

$\therefore h_{3S} = h_{f3} + x_{3S}\, h_{fg3}$

$= 604.7 + 0.971\ (2132.9)$

$= 2676.25$ kJ/kg

Process 3-4s is isentropic i.e., $S_3 = S_{4S}$

i.e., $6.8943 = 0.6493 + x_{4S}\,(7.5018)$

$\therefore x_{4S} = 0.832$

$\therefore h_{4S} = 191.8 + 0.832\ (2392.9) = 2183.8$ kJ/kg

Given, η_t (before bleeding) = η_t (after bleeding)

We have, η_t (before bleeding) $= \dfrac{h_2 - h_3}{h_2 - h_{3S}} = \dfrac{3117.5 - 2737.6}{3117.5 - 2676.25} = 0.86$

$$\therefore 0.86 = \frac{h_3 - h_4}{h_3 - h_{4S}} = \frac{2737.6 - h_4}{2737.6 - 2183.8} \quad \therefore h_4 = 2261.33 kJ/kg$$

But $h_4 = h_{f4} + x_4\, h_{fg4}$

$2261.33 = 191.8 + x_4\,(2392.9)$

$\therefore x_4 = 0.865$

i.e., Dryness fraction at entry to condenser = x_4 = **0.865**

iii) Let m kg of steam is bled. Applying energy balance to FWH,

$mh_3 + (1 - m)\, h_6 = h_7$

We have $W_{P1} = (h_6 - h_5) \quad = v\int dP$

GETMYUNI

$= 0.0010102\ (4 - 0.1)\ 10^5/10^3$

$= 0.394$ kJ/kg

$\therefore h_6 = 0.394 + 191.8 = 192.19$ kJ/kg

Substituting,

$m\ (2737.6) + (1 - m)\ 192.19 = 604.7$

$\therefore m = 0.162$ kg

Also, $W_{P2} = (h_1 - h_7) = v\int dP$

$= 0.0010839 \times (30 - 4)\ 10^2$

$= 2.82$ kJ/kg


$\therefore h_1 = 2.82 + 604.7 = 607.52$ kJ/kg

$$\therefore \eta_{cycle} = \frac{W_T = W_P}{Q_H} = \frac{[(h_2 - h_3) + (1-m)(h_3 - h_4)] - [(1-m)(h_6 - h_5) + (h_1 - h_2)]}{(h_2 - h_1)}$$

η_{cycle} = 0.31

6. In an ideal reheat regenerative cycle, the high pressure turbine receives steam at 20 bar, 300^{0}C. After expansion to 7 bar, the steam is reheated to 300^{0}C and expands in an intermediate pressure turbine to 1 bar. A fraction of steam is now extracted for feed water heating in an open type FWH. The remaining steam expands in a low pressure turbine to a final pressure of 0.05 bar. Determine (i) cycle thermal η, (ii) specific steam consumption, (iii) quality of steam entering condenser.

Solution:

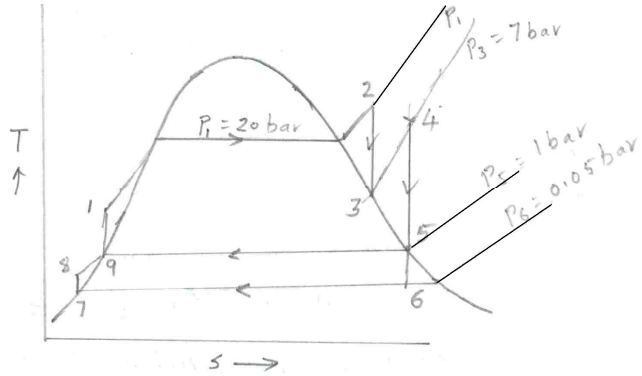

GETMYUNI

$h_2 = h\big|_{20\,bar,300^0C} = 3025 kJ/kg$ and $s_2 = 6.7696$kJ/kg-K

Process 2-3 is isentropic

i.e., $S_2 = S_3$

$6.7696 = 1.9918 + x_3\,(4.7134)$

$\therefore x_3 = 1.014$

i.e., state 3 can be approximated as dry saturated.

$\therefore h_3 = h\big|_{7\,bar,\,dry\,sat.} = 2762$kJ/kg

$\therefore h_4 = h\big|_{7\,bar,300^0C} = 3059.8 kJ/kg$ and $s_4 = 7.2997$ kJ/kg-K

Process 4-5 is isentropic i.e., $S_4 = S_5$

$7.2997 = 1.3027 + x_5\,(6.0571)$

$\therefore x_5 = 0.99$

$\therefore h_5 = h_{f5} + x_5\, h_{fg5} = 417.5 + 0.99\,(2257.9) = 2652.9$ kJ/kg

Process 5-6 is isentropic i.e., $S_5 = S_6$

$7.2997 = 0.4763 + x_6\,(7.9197)$

$\therefore x_6 = 0.862$

$\therefore h_6 = 137.8 + 0.862\,(2423.8) = 2226.1$ kJ/kg

$h_7 = h_7 = h_f\big|_{0.05\,bar} = 137.8$ kJ/kg

Neglecting W_{P1}, $h_8 = h_7$, Also neglecting W_{P2}, $h_9 = h_1$

$\therefore h_9 = h_f\big|_{1bar} = 417.5$ kJ/kg

Applying energy balance to FWH

GETMYUNI

$mh_5 + (1 - m)\, h_8 = h_9$

i.e., m (2652.9) + (1 – m) 137.8 = 417.5 $\quad \therefore m = 0.111$ kg/kg of steam


$$(i) \quad \eta_C = \frac{(h_2 - h_3) + (h_4 - h_5) + (1-m)(h_5 - h_6)}{(h_2 - h_1) + (h_4 - h_3)} = 0.35$$

$$(ii) \quad SSC = \frac{3600}{W_{net}} = 3.57 kg / kWh$$

(iii) Quality of steam entering condenser, $x_6 = 0.862$

7. The net power output of a regenerative – reheat cycle power plant is 80mW. Steam enters the high pressure turbine at 80 bar, 500^{0}C and expands to a pressure P_2 and emerges as dry vapour. Some of the steam goes to an open feed water heater and the balance is reheated at 400^{0}C at constant pressure P_2 and then expanded in the low pressure turbine to 0.05 bar. Determine (i) the reheat pressure P_2, (ii) the mass of bled steam per kg boiler steam, (iii) the steam flow rate in HP turbine, (iv) cycle η. Neglect pump work. Sketch the relevant lines on h-s diagram. Assume expansion in the turbines as isentropic.

Solution:

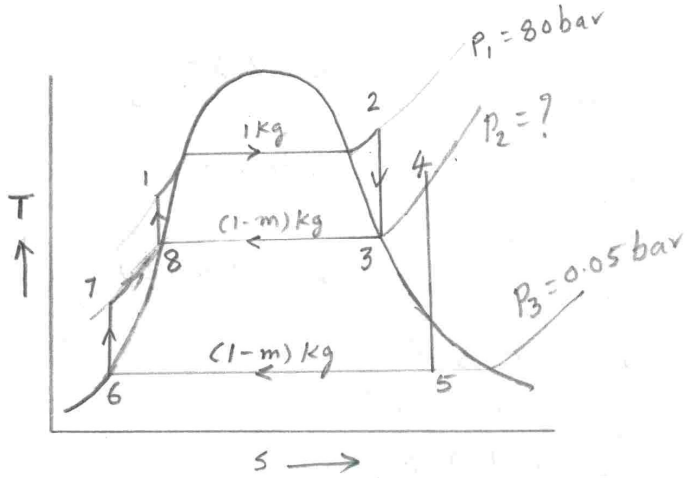

P = 80000 kW $\quad P_1 = 80$ bar $\quad t_2 = 500^0$C $\quad P_2 = ?$ $\quad t_3 = 400^0$C

GETMYUNI

$P_3 = 0.05$ bar m = ? $\dot{m}_S$ = ? η_{cycle} = ?

$h_2 = h\big|_{80\,bar,500^0C} = 3398.8 kJ/kg$ and $s_2 = 6.7262$

Process 2-3 is isentropic i.e., $S_2 = S_3 = 6.7262$ kJ/kg-K

Given state 3 is dry saturated i.e., $S_3 = 6.7262 = S_g\big|_{P_2}$

From table A – 1, for dry saturated steam, at P = 6.0 bar, $S_g = 6.7575$

and at P = 7.0 bar, $S_g = 6.7052$

Using linear interpolation,

$$\Delta P = \frac{6.0 - 7.0}{(6.7575 - 6.7052)} x(6.7262 - 6.7052) = 0.402\ bar$$

$\therefore$ (i) $P_2 = 6 + 0.402 = 6.402$ bar

$\therefore h_3 = h\big|_{P_2 = 6.4 bar}$

From table A – 1, For P = 6 bar $h_g = 2755.5$ $S_g = 6.7575$

For P = 7 bar, $h_g = 2762.0$ $S_g = 6.7052$

$$\therefore For\ P = 6.4\ bar \Rightarrow \frac{2762 - 2755.5}{1} x(0.4) + 2755.5 = 2758.1 kJ/kg$$

$\therefore h_3 = 2758.1$ kJ/kg

$h_4 = h\big|_{6.4 bar, 400^0C}$

From superheated steam tables, For P = 6.0 bar, h = 3270.6 s = 7.709

P = 7.0 bar, h = 3269.0 s = 7.6362

$\therefore$ For 6.4 bar, $h_4 \Rightarrow 3269.96$ kJ/kg

$S_4 \Rightarrow 7.6798$ kJ/kg-K

Process 4-5 is isentropic, $S_4 = S_5$

GETMYUNI

i.e., $7.6798 = 0.4763 + x_5 (7.9197)$

$\therefore x_5 = 0.909$

$\therefore h_5 = 137.8 + 0.909 (2423.8) = 2342.41$ kJ/kg

$h_6 = h_f \big|_{0.05\,bar} = 137.8 kJ/kg$

$h_7 = h_6$ (since W_{P1} is neglected)

$h_8 = h_f \big|_{6.4\,bar} = 681.1 kJ/kg$

$h_1 = h_8$ (since W_{P2} is neglected)

(ii) Applying energy balance to FWH,

$mh_3 + (1 - m) h_7 = h_8$

$m (2758.1) + (1 - m) 137.8 = 681.1$

$\therefore m = 0.313$ kg/kg of steam

(iii) $W_1 = W_{HP} = (h_2 - h_3) = (3398.8 - 2758.1)$

$= 640.7$ kJ/kg

$W_2 = W_{LP} = (1 - m) (h_4 - h_5)$

$= (1 - 0.313) (3269.96 - 2342.41)$

$= 637.2$ kJ/kg

$\therefore W_{net} = W_1 + W_2 = 1277.9$ kJ/kg

$\therefore$ Steam flow rate through HP turbine $= \frac{Power}{W_{net}} = \frac{80000}{1277.9} = 62.6 kg/s$


(iv) $\eta_{cycle} = ?$ $Q_H = (h_2 - h_1) + (1 - m) (h_4 - h_3) = 3069.35$ kJ/kg

$\therefore \eta_{cycle} = \frac{W_{net}}{Q_H} = \frac{1277.9}{3069.35} = 0.42$

GETMYUNI

8. In a single heater regenerative cycle, the steam enters the turbine at 30 bar, 400^{0}C and the exhaust pressure is 0.01 bar. The feed water heater is a direct contact type which operates at 5 bar. Find (i) thermal η and the steam rate of the cycle, (ii) the increase in mean temperature of heat addition, η and steam rate as compared to the Rankine cycle without regeneration. Pump work may neglected.

Solution:

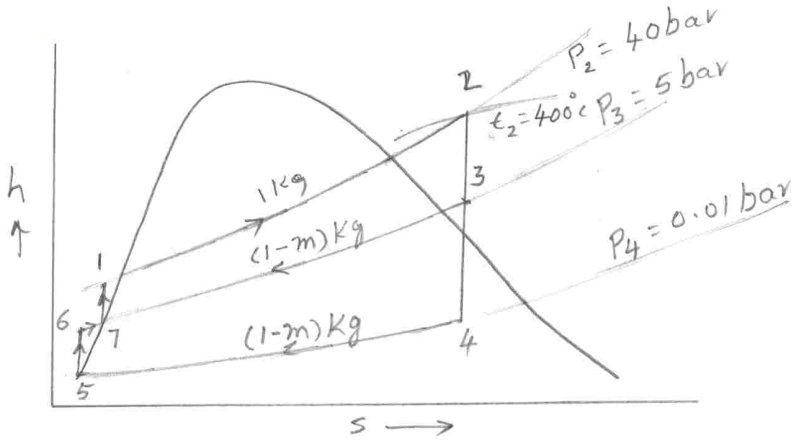

$P_2 = 40$ bar $t_2 = 400^0$C $P_4 = 0.01$ bar $P_3 = 5$ bar

From h-s diagram,

$$h_2 = h\big|_{30\,bar,400^0\,C} = 3230 kJ/kg$$

$h_3 = 2790$ kJ/kg

$h_4 = 1930$ kJ/kg

$h_5 = 29.3$ kJ/kg

$h_7 = 640.1$ kJ/kg

Since pump work may neglect, $h_6 = h_5$ & $h_1 = h_7$

(i) η_{cycle} = ?

Let m = mass of steam bled per kg boiler steam

Applying SFEE to FWH,

$mh_3 + (1 - m)\, h_6 = h_7$

$m\,(2790) + (1 - m)\, 29.3 = 640.1$

GETMYUNI

$\therefore$ m = 0.221 kg/kg of boiler steam

W_T $= (h_2 - h_3) + (1 - m)(h_3 - h_4)$

$= (3230 - 2790) + (1 - 0.221)(2790 - 1930)$

$= 1109.73$ kJ/kg

Q_H $= (h_2 - h_1) = (3230 - 640.1)$

$= 2589.9$ kJ/kg

$\therefore \eta_{cycle} = \frac{W_T}{Q_H} = 0.428$ Since W_P is neglected

$(ii)\ steam\ rate = \frac{3600}{W_T} = 3.24 kg/kWh$

(iii) Mean temperature of heat addition, $\Delta T_m = \frac{Q_H}{s_2 - s_5}$


From h-s diagram, $s_2 = 6.83$ kJ/kg-K

From steam tables, $s_5 = 0.1060$ kJ/kg-K

$$\therefore \Delta T_m = \frac{2589.9}{(6.83 - 0.106)} = 385.2^0 K$$

Case (ii) Rankine cycle without Regeneration:

GETMYUNI

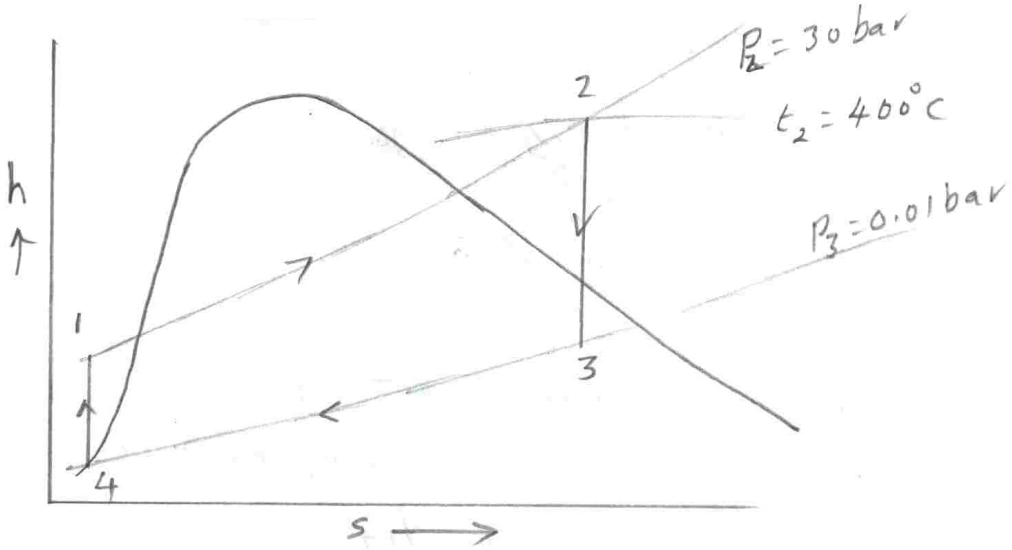

From h-s diagram,

$h_2 = 3230$ kJ/kg

$h_3 = 1930$ kJ/kg

$h_4 = 29.3$ kJ/kg

$h_1 = h_4$

$S_2 = 6.83$ kJ/kg-K

$S_4 = 0.1060$ kJ/kg-K

$$(i) \quad \eta_{cycle} = \frac{W_T}{Q_H} = \frac{(h_2 - h_3)}{(h_2 - h_1)}$$

$$= \frac{1300}{3200.7} = 0.41$$

$$(ii) \quad Steam\ rate = \frac{3600}{W_T} = 2.76 kg/kWh$$

(iii) Mean temperature of heat addition, $\Delta T_m = \frac{3200.7}{(6.83 - 0.106)} = 476^0 K$

GETMYUNI

Comparison	ΔT_m	η_{cycle}	Steam rate
Rankine cycle with regeneration	385.2 K	0.428	3.24 kg/kWh
Rankine cycle without regeneration	476^0K	0.41	2.76kg/kWh
∴Increase w.r.t Rankine cycle	- 0.19 i.e., (-19%)	0.044 (4.4%)	0.174 (17.4%)

GETMYUNI