

Stress Concentration Factor for Various Machine Members

The following tables show the theoretical stress concentration factor for various types of members.

Table 1.1 Theoretical stress concentration factor (K_t) for a plate with hole (of diameter d) in tension.

$\frac{d}{b}$	0.05	0.1	0.15	0.20	0.25	0.30	0.35	0.40	0.45	0.50	0.55
K_t	2.83	2.69	2.59	2.50	2.43	2.37	2.32	2.26	2.22	2.17	2.13

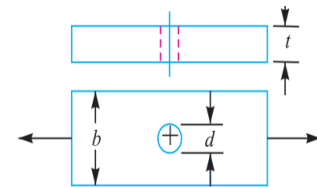


Table 1.2 Theoretical stress concentration factor (K_t) for a shaft with transverse hole (of diameter d) in bending.

$\frac{d}{D}$	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
K_t	2.70	2.52	2.33	2.26	2.20	2.11	2.03	1.96	1.92	1.90

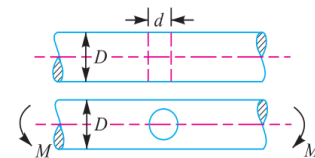


Table 1.3 Theoretical stress concentration factor (K_t) for stepped shaft with a shoulder fillet (of radius r) in tension.

$\frac{D}{d}$	Theoretical stress concentration factor (K_t)									
	r/d									
	0.08	0.10	0.12	0.16	0.18	0.20	0.22	0.24	0.28	0.30
1.01	1.27	1.24	1.21	1.17	1.16	1.15	1.15	1.14	1.13	1.13
1.02	1.38	1.34	1.30	1.26	1.24	1.23	1.22	1.21	1.19	1.19
1.05	1.53	1.46	1.42	1.36	1.34	1.32	1.30	1.28	1.26	1.25
1.10	1.65	1.56	1.50	1.43	1.39	1.37	1.34	1.33	1.30	1.28
1.15	1.73	1.63	1.56	1.46	1.43	1.40	1.37	1.35	1.32	1.31
1.20	1.82	1.68	1.62	1.51	1.47	1.44	1.41	1.38	1.35	1.34
1.50	2.03	1.84	1.80	1.66	1.60	1.56	1.53	1.50	1.46	1.44
2.00	2.14	1.94	1.89	1.74	1.68	1.64	1.59	1.56	1.50	1.47

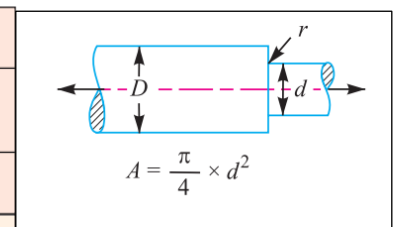


Table 1.4 Theoretical stress concentration factor (K_t) for a stepped shaft with a shoulder fillet (of radius r) in bending.

$\frac{D}{d}$	Theoretical stress concentration factor (K_t)									
	r/d									
	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
1.01	1.85	1.61	1.42	1.36	1.32	1.24	1.20	1.17	1.15	1.14
1.02	1.97	1.72	1.50	1.44	1.40	1.32	1.27	1.23	1.21	1.20
1.05	2.20	1.88	1.60	1.53	1.48	1.40	1.34	1.30	1.27	1.25
1.10	2.36	1.99	1.66	1.58	1.53	1.44	1.38	1.33	1.28	1.27
1.20	2.52	2.10	1.72	1.62	1.56	1.46	1.39	1.34	1.29	1.28
1.50	2.75	2.20	1.78	1.68	1.60	1.50	1.42	1.36	1.31	1.29
2.00	2.86	2.32	1.87	1.74	1.64	1.53	1.43	1.37	1.32	1.30
3.00	3.00	2.45	1.95	1.80	1.69	1.56	1.46	1.38	1.34	1.32
6.00	3.04	2.58	2.04	1.87	1.76	1.60	1.49	1.41	1.35	1.33

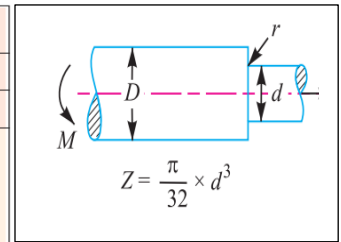


Table 1.5 Theoretical stress concentration factor (K_t) for a stepped shaft with a shoulder fillet (of radius r) in torsion.

$\frac{D}{d}$	Theoretical stress concentration factor (K_t)									
	r/d									
	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
1.09	1.54	1.32	1.19	1.16	1.15	1.12	1.11	1.10	1.09	1.09
1.20	1.98	1.67	1.40	1.33	1.28	1.22	1.18	1.15	1.13	1.13
1.33	2.14	1.79	1.48	1.41	1.35	1.28	1.22	1.19	1.17	1.16
2.00	2.27	1.84	1.53	1.46	1.40	1.32	1.26	1.22	1.19	1.18

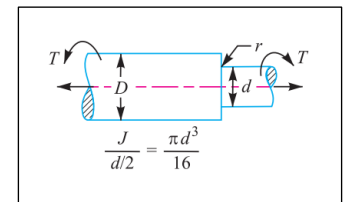


Table 1.6 Theoretical stress concentration factor (K_t) for a grooved shaft in tension.

$\frac{D}{d}$	Theoretical stress concentration (K_t)									
	r/d									
	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
1.01	1.98	1.71	1.47	1.42	1.38	1.33	1.28	1.25	1.23	1.22
1.02	2.30	1.94	1.66	1.59	1.54	1.45	1.40	1.36	1.33	1.31
1.03	2.60	2.14	1.77	1.69	1.63	1.53	1.46	1.41	1.37	1.36
1.05	2.85	2.36	1.94	1.81	1.73	1.61	1.54	1.47	1.43	1.41
1.10	..	2.70	2.16	2.01	1.90	1.75	1.70	1.57	1.50	1.47
1.20	..	2.90	2.36	2.17	2.04	1.86	1.74	1.64	1.56	1.54
1.30	..	..	2.46	2.26	2.11	1.91	1.77	1.67	1.59	1.56
1.50	..	..	2.54	2.33	2.16	1.94	1.79	1.69	1.61	1.57
2.00	..	..	2.61	2.38	2.22	1.98	1.83	1.72	1.63	1.59
∞	..	..	2.69	2.44	2.26	2.03	1.86	1.74	1.65	1.61

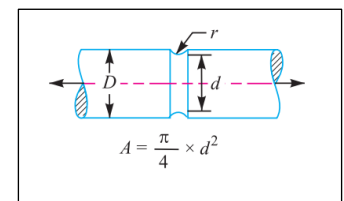


Table 1.7 Theoretical stress concentration factor (K_t) of a grooved shaft in bending.

$\frac{D}{d}$	Theoretical stress concentration factor (K_t)									
	r/d									
	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
1.01	1.74	1.68	1.47	1.41	1.38	1.32	1.27	1.23	1.22	1.20
1.02	2.28	1.89	1.64	1.53	1.48	1.40	1.34	1.30	1.26	1.25
1.03	2.46	2.04	1.68	1.61	1.55	1.47	1.40	1.35	1.31	1.28
1.05	2.75	2.22	1.80	1.70	1.63	1.53	1.46	1.40	1.35	1.33
1.12	3.20	2.50	1.97	1.83	1.75	1.62	1.52	1.45	1.38	1.34
1.30	3.40	2.70	2.04	1.91	1.82	1.67	1.57	1.48	1.42	1.38
1.50	3.48	2.74	2.11	1.95	1.84	1.69	1.58	1.49	1.43	1.40
2.00	3.55	2.78	2.14	1.97	1.86	1.71	1.59	1.55	1.44	1.41
∞	3.60	2.85	2.17	1.98	1.88	1.71	1.60	1.51	1.45	1.42

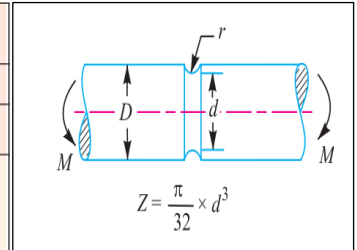


Table 1.8 Theoretical stress concentration factor (K_t) for a grooved shaft in torsion.

$\frac{D}{d}$	Theoretical stress concentration factor (K_{ts})									
	r/d									
	0.02	0.04	0.08	0.10	0.12	0.16	0.20	0.24	0.28	0.30
1.01	1.50	1.03	1.22	1.20	1.18	1.16	1.13	1.12	1.12	1.12
1.02	1.62	1.45	1.31	1.27	1.23	1.20	1.18	1.16	1.15	1.16
1.05	1.88	1.61	1.40	1.35	1.32	1.26	1.22	1.20	1.18	1.17
1.10	2.05	1.73	1.47	1.41	1.37	1.31	1.26	1.24	1.21	1.20
1.20	2.26	1.83	1.53	1.46	1.41	1.34	1.27	1.25	1.22	1.21
1.30	2.32	1.89	1.55	1.48	1.43	1.35	1.30	1.26	—	—
2.00	2.40	1.93	1.58	1.50	1.45	1.36	1.31	1.26	—	—
∞	2.50	1.96	1.60	1.51	1.46	1.38	1.32	1.27	1.24	1.23

